LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74. Mich. P.A. 1970

For corners in	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>45H</u> R TR TR	31N I9
2. Property Controlling	TR S_26T_45H_R	31W 4
In Section	ST_R	


Register of Deeds Stamp & File Number

Property in Sec.

Nov 01 1995

, Stephan J. Szyszkoski , in a field survey on _____, 19 _____do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Burseu of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 comers, all in the same fown and range, may be recorded on this certificate.

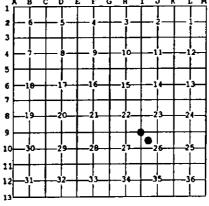

A. Description of original monument and accessories and/or subsequent restoration:
(I9) Corner comon to Sections 22-23-26-27. Corner established in 1849 by John Burt: "80.00 Set maple post corner of Sec. 22,23,26,27.
Lyan 8 \$28# 15, Hemlock 10 #23E 28". Found no subsequent record.

(4-Sec. 26) Horthwest 1/16 corner, Section 26. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(IP) Original post and accessories not recovered. Found a 1"square iron pin adjacent to an old post with a 1 1/4" iron pipe, all at a fence corner with standing fence north and south. I note that the pin has been used in the past by at least two others as control for establishing 1/16 corners on the north and west lines of Section 26. I found distances east and south to remonumented section corners to be 5285.01', and 5228.69', respectively. I accepted the pin as the best available evidence of the position of the original corner. Left the pin in place and marked 4 new mitnesses as described below.

(4-Sec. 26) Found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite 1/16 corners. At the position for the corner, I placed a 1° IDx36° iron pipe capped with a 4° dia. cast aluminum MDNR tablet, appropriately stamped. From the corner monumented, I found a 1 1/2° iron pipe at a fence corner SOSE 15.8' distant.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Bearings are magnetic.

(19) Found 1" square iron pin. (4-Sec. 26) Set 1" pipe with 4" cap. 8lazed and scribed the following new Blazed and scribed the following bearing trees:

bearing trees: trees: 10° Sugar S37W 10.7′ "S27 MBT" 7° Sugar 10° Sugar N37W 17.6′ "S22 MBT" 10° Sugar

"\$23 MBT" "\$26 MBT"

8" Sugar N25E 13.0'

7° Sugar S87E 4.8' Bearings are magnetic. 7" Sugar S48E 10.8" "1/16S 8T" 10" Sugar S89E 20.3" "1/16S BT"

12" Sugar NOSM 38.4' "1/16S BT" 4" Sugar S88M 18.2' "1/16S BT" STEPHAN J. SZYSZKOSKI LAND SURVEYOR No. 33986

Signed by Styche J. Synghol.
Surveyor's Michigan License No. 33986

Date 11-27-95

For the Michigan Department of Matural Resources - Forest Management Division