LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

4. Lot No. 5. Private Claims

Iron	Located In:					Corner Code #	
(County)							
1. Public Land Survey			T		R		
			T	45N		31W	G3
	_		1		R		
2. Property Controlling	S	4	ı	45N	ĸ	31W	14
in Section	S ⁻		- T		R'		-
	S		- T		R.		
3. Miscellaneous	s ⁻		- T		R.		
Property in Sec.	s-				R		


, Recorded Plat

Register of Deeds Stamp & File Number

06/23/2010 i, Stephan J. Szyszkoski, in a field survey on do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey 5 instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of $\bf 6$ a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with 7 the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, a re-established, monumented, recovered, found as expressed below: NOTE: Not more than 2 corners, all in the same town and range, may be recorded

on this certificate.

and faithful establishment of the position of the corner.

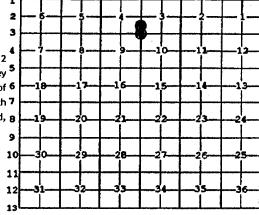

A. Description of original monument and accessories and/or subsequent restoration:

(14-Sec. 4) South 1/16 corner between Sections 3 and 4. 1970 - Established by A.O.Enger RLS on line between section corner 19.988 ch. south and 1/4 corner 19.988 ch. north. Set 1"IDx36" iron pipe with 4" aluminum cap. Tamarack 14" S55E 18.3'. No other trees or suitable objects near.

- (G3) Corner common to Sections 3-4-9-10. 1970 Reestablished by A.O.Enger RLS by double proportionate measurement from corners 1 mile N., 1.5 miles S., 3 miles E., and 1 mile W. 1"IDx36" I.pipe with 4" aluminum cap. B.Spruce 10" N09E 17.0', B.Spruce 12" S64E 26.2', B.Spruce 10" S40W 65.4'.
- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner: (14-Sec. 4) Found the 1970 monument in good condition, squared cedar post adjacent, at record bearing and distance from the Tamarack BT witness, now a dead stub with scribing visible. Checked the position of the monument with respect to section corner 1318.80' south and quarter corner 1318.57' north and found it to be substantially in accord with the record. Accepted the monument as a careful
- (G3) Found the 1970 monument in good condition and at record bearing and distance from the 1970 witnesses, now all dead and down. Accepted the monument as a careful and faithful reestablishment of the position of the original corner.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(14) Found 1"ID I.pipe with 4" alum. MDNR cap. Set measuring nail with MDNR tag in the side of: mrkd "1/16S BT" 11" Spruce S20E 66.5' 2" Tamarack N89E 37.5' mrkd " X X "

do

2" Tamarack S64E 26.3' 2" Tamarack N44W 40.0'

do

Bearings are magnetic.

8" Spruce S89E 7.5' 11" W.Birch S24W 7.4'

Set measuring nail with MDNR tag in the side of: mrkd *S10 NBT" "S9 NBT"

4" Spruce S77W 14.8'

9" Spruce N14W 17.4'

"S9 NBT"

"S4 NBT"

Sq'd cedar post adjacent. Bearings magnetic.

(G3) Found 1"ID I.pipe with 4" alum. MDNR cap.

Signed by Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources and Environment, Forest Manageme

08/26/2010

YSZKOSK LAND

STEPHAN J

IRVEYO

16501 16502 FORM APPROVED BY MICHIGAN STATE BOARD

Rervised Oct., 1995

ed Jan., 1983