


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

| | | | |
|---|---------------------------|----------------------|--|
| <u>Iron</u> | Located In: | Corner Code # | |
| <small>(County)</small> | | | |
| 1. Public Land Survey | T <u>45N</u> R <u>32W</u> | <u>811</u> | |
| | T <u>45N</u> R <u>32W</u> | <u>C11</u> | |
| | T _____ R _____ | _____ | |
| | T _____ R _____ | _____ | |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ | |
| | S _____ T _____ R _____ | _____ | |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ | |
| | S _____ T _____ R _____ | _____ | |

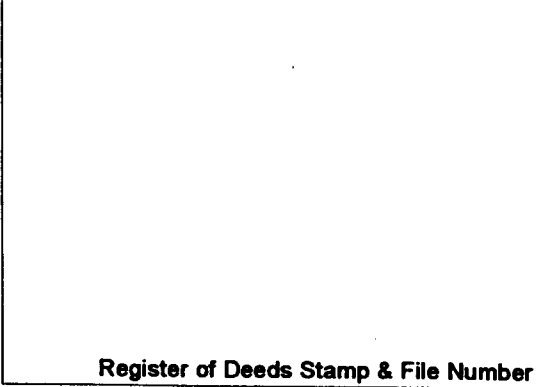

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Apr 18 2002

I, Stephan J. Szyszkoski, in a field survey on _____, 20__ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

| | | | | | | | | | | | | |
|----|----|----|----|----|----|----|---|---|---|---|---|---|
| A | B | C | D | E | F | G | H | I | J | K | L | M |
| 1 | | | | | | | | | | | | |
| 2 | 6 | 5 | 4 | 3 | 2 | 1 | | | | | | |
| 3 | | | | | | | | | | | | |
| 4 | 7 | 8 | 9 | 10 | 11 | 12 | | | | | | |
| 5 | | | | | | | | | | | | |
| 6 | 18 | 17 | 16 | 15 | 14 | 13 | | | | | | |
| 7 | | | | | | | | | | | | |
| 8 | 19 | 20 | 21 | 22 | 23 | 24 | | | | | | |
| 9 | | | | | | | | | | | | |
| 10 | 30 | 29 | 28 | 27 | 26 | 25 | | | | | | |
| 11 | ● | ● | | | | | | | | | | |
| 12 | 31 | 32 | 33 | 34 | 35 | 36 | | | | | | |
| 13 | | | | | | | | | | | | |

A. Description of original monument and accessories and/or subsequent restoration:
 (B11) Quarter corner common to Sections 30-31. Remonumented in 1951 by Dean C. DeLaMater, RLS: This corner was pointed out to me by George Divine, District Forester of Crystal Falls. One original B.T. in place, in fair condition. Set 1" pipe with 4" brass cap. Witnessed by 25" Y.Birch S60W 61 links, 14" H.Maple N10W 62 links, 12" H.Maple N58E 36 links.
 (C11) Corner common to Sections 29-30-31-32. Reestablished in 1983 by K.L.Sackett, RLS: Restored 3/29/83 by double proportion from corners north-south-east-west. Land calls also fit good. Set 1"IDx30" I.P. with 4" alum. cap, Witnesses: 3" Spruce S60E 5.0', 3" Spruce N10W 7.3', 6" Spruce S24W 23.5'. Mr. Sackett's calculations show distance west to 1/4 corner 2630.1' and east to quarter corner 2635.1'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 (B11) The 1951 monument was not recovered. It has apparently been removed by others. Remonumented the corner at the 1951 position. The new monument was driven into the recovered 1" dia. hole resulting from the removal of the 1951 monument, which hole was found at record bearing and distance from the remains of the 1951 Y.Birch and H.Maple N10W NBTs, both now rotting stumps. Also at record bearing and distance is the remains of the original W.Pine BT S05W 15.8', in poor condition.
 (C11) Recovered the 1983 monument, which has been driven to 6" below ground, with the cap removed, at record bearing and distance from the 1983 accessories. The spruce NBTs SE and SW are in good condition with blazes overgrown. The spruce NW is dead and leaning. Left the monument in place and made new accessories as described below. From the corner, the westerly-most corner of a camp building is N82E 144.7' distant. Distances to Quarter corners West and East check with the 1983 measurements - 2629.76' west (M) and 2634.22' east (M).

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 (B11) Set 1"IDx32" I.pipe with 4" alum. MDNR cap. Blazed and scribed:
 10" Sugar N03E 19.5' "1/4S NBT"
 7" Maple S75E 3.6' do
 6" Maple in clump S01E 10.8' do
 8" Maple S60W 16.5' do
 Squared cedar post adjacent. Bearings are magnetic. Distances to notch in lower blaze.
 (C11) Found 1"ID I.Pipe driven to 6" b.g. Blazed and scribed:
 8" R.Pine S66W 8.5' "S31 NBT"
 7" R.Pine N43W 2.6' "S30 NBT"
 The 1983 wits:
 5" Spruce S62E 5.0' blazes overgrown
 8" Spruce S26W 23.5' do
 Bearings are magnetic. Distances to notch in lower blaze.



Signed by Stephan J. Szyszkoski Date 6/7/02
 Surveyor's Michigan License No. 33986