

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 45 <sup>N.</sup> <del>35</del> , R. 34 <sup>EX</sup> <sub>W.</sub>	B11 & C12
2. PROPERTY CONTROLLING IN SECTION _____	30, T. 45 <sup>N.</sup> <del>35</del> , R. 34 <sup>EX</sup> <sub>W.</sub>	16
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ <sup>N.</sup> _____, R. _____ <sup>E.</sup> <sub>W.</sub>	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on see below 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

- Corner B11: Wood post (Not found. Found wood post app. cor. N48E 23 ft.)
  - Y. Birch 10 S25E 36 (Not found. No subsequent accessories found.)
  - Spruce 10 N14E 64 (Not found. No subsequent accessories found.)
- Corner C12: Wood post (Not found. Found steel fence post app. cor. N72E 23.5 ft)
  - Spruce 12 N30E 7 (Not found. No subsequent accessories found.)
  - Fir 10 West 4 (Not found. No subsequent accessories found.)
- Corner 16: Not established in original survey nor subsequently, apparently.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

- Corner B11: Re-established 1/22/74 proportionately on line between Sec. Cor. 40.456 ch. E and 39.486 ch. W.
- Corner C12: Re-established 11/23/73 on line between Sec. Cor. 40.017 ch. to N and to S. Found channel of stream about 8 lks. N of corner, as in original field notes, but as beaver activity has created several new channels in vicinity, it is not positive that this is the original one.
- Corner 16: Established 1/22/74 on line between Sec. Cor. 20.228 ch. E and 1/4 cor. 20.228 ch. W. Small stream c SE in marsh is about 1/2 ch. W.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- Corner B11: 1" I.D. x 36" iron pipe with 4" aluminum cap
  - W. Spruce 12 N22½°W (mag.) 29.3 ft. "1/4S, NBT"
  - W. Spruce 7 S 6°W (mag.) 23.5 ft. "1/4S, NBT"
- Corner C12: 1" I.D. x 36" iron pipe with 4" aluminum cap.
  - W. Pine 36 N34½°W (mag.) 62.4 ft. "1/4S, NBT"
  - W. Birch 8 N20½°E (mag.) 123.9 ft. "1/4S, NBT"
- Corner 16: 1" I.D. x 32" iron pipe with 3½" aluminum cap.
  - Tamarack 9 N79½° E (mag.) 106.9 ft. "1/16S, BT"
  - W. Spruce 10 S2°W (mag.) 51.3 ft. "1/16S, BT"

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_


SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ (SEAL)

**FOR STATE AND UNITED STATES AGENCIES:**

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Arthur O. Enger DATE May 27 1975

CHIEF OF SURVEY PARTY  
 MICHIGAN REGISTERED LAND SURVEYOR  
 Arthur O. Enger  
 Michigan Department of Natural Resources

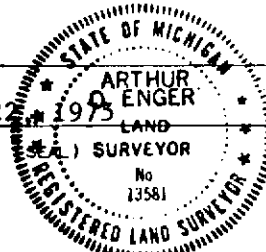

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581