

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>45</u> ^{N.} XX R. <u>34</u> ^{XX} W.	F9
2. PROPERTY CONTROLLING IN SECTION	<u>21</u> , T. <u>45</u> ^{N.} XX R. <u>34</u> ^{XX} W.	15, 15a. & 16
3. MISCELLANEOUS PROPERTY IN SECTION	, T. _____ ^{N.} S. R. _____ ^{E.} W.	
4. LOT NO. _____ , RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on see below 19___, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19___, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner F9: Wood post (Not found. No subsequent monuments found.)
 Spruce 6 N4°W 41 (Not found. No subsequent accessories found.)
 Spruce 6 S4°W 35 (Not found. No subsequent accessories found.)
 Corner 15a: Wood meander post (Not found. No subsequent monuments found.)
 W. Ash 6 N80E 4 (Not found. No subsequent accessories found.)
 B. Ash 7 S65E 16 (Not found. No subsequent accessories found.)
 Corners 15 & 16: Not established in original nor subsequently, apparently, except that Corner 16 was established by proximation only.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner F9: Re-established 7/22/74 on line between Sec. Cor. 40.022 ch. to E and to W.
 Corner 15: Established 7/22/74 on line between Sec. Cor. 20.011 ch. W and 1/4 cor. 20.011 ch. E. Found blazed 7" aspen N46°W 13.6 ft. and blazed 8" balsam N49°W 22.0 ft. for approx. corners.
 Corner 15a: Re-established 8/26/74 on E bank of Net River on true sec. line, 4.355 ch. E of Sec. Cor. 20, 21, 28, & 29 and 35.667 ch. W of 1/4 cor. 21 & 28. Probably not in same place as original M.C.
 Corner 16: Established 7/22/74 on line between Sec. Cor. 20.011 ch. E and 1/4 cor. 20.011 ch. W.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Witnesses for Corner F9: W. Birch 6 N69°E (mag.) 13.2 ft. "1/4S, NBT"
 B. Spruce 5 S 3°W (mag.) 8.6 ft. "1/4S, NBT"
 Witnesses for Corner 15: Cedar 11 S4½°E (mag.) 44.4 ft. "1/16S, BT"
 W. Birch 8 S59°W (mag.) 30.5 ft. "1/16S, BT"
 Witnesses for Corner 15a: B. Ash 24 N84°E (mag.) 23.3 ft. "M.C., NBT"
 B. Ash 8 S31°E (mag.) 21.1 ft. "M.C., NBT"
 Witnesses for Corner 16: Y. Birch 14 N12°E (mag.) 15.3 ft. "1/16S, BT"
 W. Birch 11 S46°W (mag.) 24.8 ft. "1/16S, BT"

Monuments for all four corners: 1" I.D. x 36" iron pipe with 3½" aluminum cap.

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE May 22, 1973

Michigan Registered Land Surveyor
 Arthur O. Enger
 Michigan Department of Natural Resources

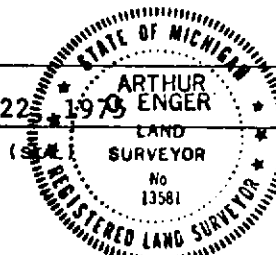

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581