

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

<u>Iron</u> (County)	Located in:	Corner Code #
1. Public Land Survey	T <u>45NR</u> <u>34W</u>	<u>F9</u>
	T <u> </u> <u> </u>	<u> </u>
	T <u> </u> <u> </u>	<u> </u>
	S <u> </u> <u> </u>	<u> </u>
2. Property Controlling in Section	S <u>16</u> T <u>45NR</u> <u>34W</u>	<u>8</u>
	S <u> </u> <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> <u> </u>	<u> </u>
	S <u> </u> <u> </u>	<u> </u>

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims

F9 Feb 17 2004
 8 May 03 2004

I, Stephan J. Szyszkoski, in a field survey on _____, 20____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


(F9) Quarter corner common to Sections 21 and 28. Reestablished in 1974 by A.O.Enger RLS midway between Section corners. Set 1"IDx36" iron pipe with 3.5" alum. cap. W.Birch 6 N69E 13.2", B.Spruce 5 S03W 8.6'.
 (8-Sec. 16) West 1/16 corner, Section 16. Not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(F9) Found and accepted the 1974 monument, 3.7' westerly of the record position, at record bearing and distance from the 1974 N8Ts as follows: The W.Birch is a dead stub, the B.Spruce was found in good condition but was cut to facilitate GPS observations at the corner. Found squared wood post adjacent to the monument.
 (8-Sec. 16) Established the corner midway and on a straight line between Center of Section 1310.05' East and E6 1310.05' West.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(F9) Found 1"ID I.pipe with alum. MDNR cap. Blazed, scribed, and set measuring nails in:	(8) Set 1"IDx32" I.pipe with 4" alum. MDNR cap. Blazed, scribed, and set measuring nails in:
8" B.Spruce N27E 44.3' "1/4S NBT"	10" W.Pine N07E 23.4' "1/16S BT"
5" B.Spruce S68E 15.0' do	11" R.Pine N80E 13.2' do
4" twin B.Spruce S07E 19.0' do	9" W.Spruce S30W 14.0' (slope) do
6" B.Spruce N39W 33.2' do	12" R.Pine N66W 6.4' do
Bearings are magnetic. Distances are to nail with tag.	Bearings are magnetic. Distances are to nail with tag. Set sq'd cedar post adjacent.

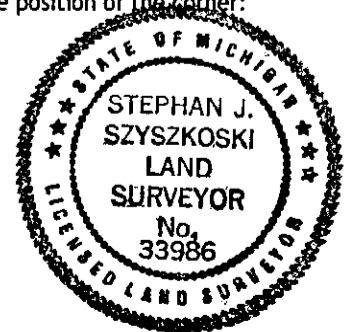

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 5/19/04

For the Michigan Department of Natural Resources, Office of Land and Facilities