

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Iron	Located In:	Corner Code #
_____	_____	_____
(County)		
1. Public Land Survey	T46N R 33W	A1
	T_____ R_____	_____
	T_____ R_____	_____
	T_____ R_____	_____
2. Property Controlling in Section	S_____ T_____ R_____	_____
	S_____ T_____ R_____	_____
3. Miscellaneous	S_____ T_____ R_____	_____
Property in Sec.	S_____ T_____ R_____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Jan 10 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1	●												
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													


A. Description of original monument and accessories and/or subsequent restoration:
 (A1) Northwest corner of the township. Remonumented in the original position by A.O. Enger in 1968. 1" I.D. x 36" iron pipe with 4" aluminum cap. Balsam Fir 7 S3W 18 links. 1953 witnesses by Northern Paper Mills remeasured by Enger: Balsam Fir 12 N52W 11.5 links, Balsam Fir 12 N66E 42.5 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(A1) Found the 1968 monument, as described, in good condition and at record bearing and distance from the NBT Balsam SW, now a rotting stump, and from the NBT Balsam NW, a rotting stump. The remains of the NBT Balsam NE were not recovered but may be under the snow. Left the monument in place and made new accessories as described below. A 1" ID iron pipe with a 2" brass NPM cap and a 3/4" ID iron pipe are adjacent to the monument

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(A1) Found 1" ID iron pipe with 4" alum.
 MDNR tablet. Blazed and scribed:
 7" W.Spruce S88E 26.0' "S6 NBT"
 4" W.Spruce S37E 30.0' "S6 NBT"
 4" Balsam S44W 29.5' "S1 NBT"
 8" W.Spruce N18W 11.2' "S36 NBT"
 Bearings are magnetic. Distances are to notch in lower blaze.

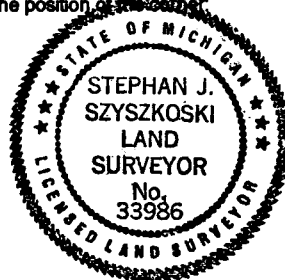

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 5/1/01

For the Michigan Department of Natural Resources - Forest Management Division