

23

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Iron _____	Located In:	Corner Code #	
(County)			
1. Public Land Survey	T <u>46N</u> R <u>34W</u>	<u>612</u>	
	T _____ R _____	_____	
	T _____ R _____	_____	
	T _____ R _____	_____	
2. Property Controlling In Section	S _____ T _____ R _____	_____	
	S _____ T _____ R _____	_____	
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____	
	S _____ T _____ R _____	_____	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Jul 21 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												


A. Description of original monument and accessories and/or subsequent restoration:
(G12) Quarter corner common to Sections 33-34. Corner established in 1852 by Zelotes B. Searles: "NB'W Corrected...39.95 Set quarter Section Post. Fir 4 S40W 15, Y. Birch 10 N28E 34." Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(G12) Original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner midway and on a line of mean true bearing between Section corners 39.9453 chains north and south. I observed the true bearing of this line to be N9°17'W. At the position for the corner I placed a 1"IDx32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(G12) Set 1" pipe with 4" MDNR cap.
Blazed and scribed the following:
13" Hemlock N08E 4.4' "1/4S N8T"
9" Sugar S67E 23.5' do
8" Sugar S60W 21.2' do
13" Hemlock N32W 20.3' do
Placed a squared sugar post adjacent.
Distances are to meas. notch. Bearings are magnetic.

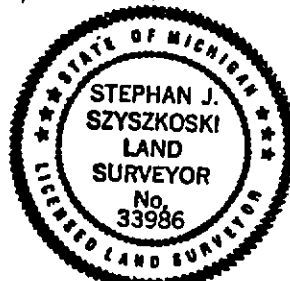

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 12/29/98

For the Michigan Department of Natural Resources - Forest Management Division