

26

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Iron	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>16N</u> R <u>34W</u>	<u>F11</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling In Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Jun 10 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11						●							
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

(F11) Quarter corner common to Sections 28-33. Corner established in 1852 by Zelotes B. Searles: "N89 deg. 50'N Corrected...39.815 Set quarter Section post. Healock 10 S63W 26, do 28 N65E 17." Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(F11) Original post was not recovered. Remonumented the corner at record bearing and distance from the recovered remains of the two Healock bearing trees. The Healock SW is still green, 22" diameter, with an old overgrown blaze. Cut the tree open to reveal scribing "1/4" and verified the proper age by the count of growth rings. The Healock BT NE is now a 3 ft. dia. rotted stump mound with no evidence remaining of markings. An Iron Co. Remonumentation Program monument at E11 bears N89 deg. 46' 49" W (true brg.), 39.6984 ch. from this position and a reestablished Section corner is N89 deg. 35'46"E 39.8467 ch. At the position for the corner I placed a 1"IDx32" iron pipe capped with a 4" dia. cast aluminum MONR tablet, appropriately stamped. Corner placed and witnessed by D.Lampela and S.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(F11) Set 1" pipe with 4" MONR cap.

Blazed and scribed the following:

12" Cedar N30E 22.1' "1/4S NBT"

8" Cedar S77E 13.8' do


15" Y. Birch S36W 58.8' do

11" Cedar N59W 34.7' do

Distances are to meas. notch. Bearings

are magnetic. Squared a 4" maple S24W

1.1' to tree center.

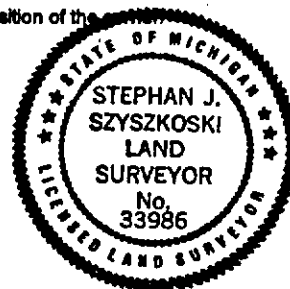

Signed by

Stephan J. Szyszkoski

Date

12/29/98

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division