LAND CORNER RECORDATION CERTIFICATE Mich. P.A. 1970


| F | Filing Requirement of Act 74 | | | |
|--|------------------------------|--------------------------|---------------|--|
| For comers in | | | | |
| Iron (County) | Located Is | n: | Corner Code # | |
| 1. Public Land Survey | | T46N R 34N T46N R 34N | ₩9 €10 | |
| Property Controlling in Section Miscellaneous Property in Sec. | s 1 s 1 s 1 | RR RR RR | | |
| 4. Lot No, Reco | rded Plat | | | |

Register of Deeds Stamp & File Number

E10 Jul 23 1998 H9 Jul 22 1998

I. Stephan J. Szyszkoski , In a field survey on ______ 19 ____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

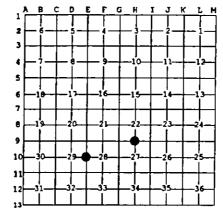

A. Description of original monument and accessories and/or subsequent restoration;

(N9) Quarter corner common to Sections 22-27. Corner established in 1852 by Zelotes B. Searles: "...39.98 Set quarter Sec. post. Fir 8 SSSE 3B. do 10 N40M 26. Found no subsequent record.

(£10) Quarter corner common to Sections 28-29. Corner established in 1852 by Zelotes 8. Searles: "MS'E Corrected...39.99 Set quarter Section post. Fir 10 SI6N 21, Maple 14 N40E 22." Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

(H9) Original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner midway and on a line of mean true bearing between Sections corners 40.0201 ch. east and west. At the position for the corner I placed a 1"IDx32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. There is a 19" spruce, squared, in the corner area, which has seemingly been used for an approximate corner. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

(E10) Original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner midway and on a line of mean true bearing between Section corners 40.0392 ch North and South. The bearing of this line was observed to be N 8' 31" W. At the position for the corner I placed a 1"IDx32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner

(H9) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following: 17" W. Spruce \$20E 8.2" "1/45 NBT" 14" Cedar 545N 48.0" do 8" Sugar N86N 20.0" do 5" Sugar NO3N 4.8" do Placed a squared sugar post adjacent. Distances are to meas, notch. Bearings are magnetic. 1.3' to tree center.

(E10) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following: 16" Cedar S43# 25.55' "1/45 MBT 14" Cedar \$82W 17.8" da 8" Sugar N57E 40.3" do 22" Hemlock S72E 71.35" do Distances are to meas, notch. Bearings are magnetic. Squared an 8° Naple M67W

OF MIC STEPHAN J SZYSZKOSKI LAND SURVEYOR LAND S

33986 Surveyor's Michigan License No.