LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Iron Comer Code # Located In: County 1. Public Land Survey

2. Property Controlling in Section 3. Miscellaneous Property in Sec.


Register of Deeds Stamp & File Number

_, Recorded Plat 4. Lot No. 5. Private Claims

> Aug 13 1998 Aug 17 1998 C9

1. Stephan J. Szyszkoski _, in a field survey on . 19 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

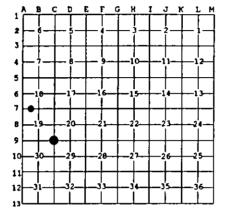

A. Description of original monument and accessories and/or subsequent restoration:

(C9) Corner common to Sections 19-20-29-30. Corner recorded in 1986 by Keith L. Sackett, RLS 19006: Restored at 1.5° ID iron pipe. Balsam M74M 4.62', Spruce M50E 14.04', Spruce S45E 9.45' (Mails with DMR tags).

(1-Sec. 19) West 1/16 corner between Sections 18-19. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

(C9) Recovered the monument noted in the 1986 record as described, in good condition, and at record bearing and distance from the cut stump remains of the two Spruce M8Ts. The nails and tags are still in place in the stumps. Distances Mest and East to original corners were found to be 40.55 ch (rec. 40 ch.) and 39.73 ch. (rec 40.03 ch) respectively. These differences are somewhat larger that the average that I have observed in this area. I leave the 1.5" ID pipe in place and mark new witnesses as described below. This corner is being recorded in order to update the accessories. Corner recovered and remitnessed by O.Lampela and B.Wheeler, Baraga District Office.

(1-Sec. 79) found no evidence of prior monumentation at the corner position. Established the corner on a line of mean true bearing between Quarter corner 20.1380 ch. East and Section corner 18.6276 ch. West, being 20 chains, proportionate, west of the quarter corner. At the position for the corner, I placed a 1° ID x 32° iron pipe capped with a 4° dia. cast aluminum HDMR tablet, appropriately stamped. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the

(C9) Found 1.5" ID iron pipe. Blazed (1) Set 1" pipe with 4" MDNR cap. and scribed the following: Blazed and scribed the following: 10" W. Spruce S01W 22.9" S29 N8T 11" Sugar N31E 35.3" "1/16S 8T "S20 N8T" 5" N. Spruce N73E 53.11 29° Cedar \$26£ 52.5' ďο "S20 NBT" 5 B. Spruce N32E 24.8 6" Sugar \$40W 16.1" dα 5" W. Birch N32W 21.45" "S19 NBT" 14" Maple NB3N 24.6" đ٥ Placed a squared cedar post adjacent. Distances are to meas, notch, Bearings are magnetic. Bearings are magnetic. Distances are to meas. notch.

SZYSZKOSKI LAND SURVEYOR

33986 Surveyor's Michigan License No

For the Michigan Department of Natural Resources - Forest Management Division