LAND CORNER RECORDATION CERTIFICATE l. Mich. P.A. 1970

For corners in	Filing Requirement of Act 74	
Iran	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>46N</u> F T <u>46N</u> F T F	₹ <u>34</u> М <u>Е6</u>
Property Controlling In Section Miscellaneous Property in Sec.	S TR S TR S TR	

Register of Deeds Stamp & File Number

4. Lot No. . Recorded Plat 5. Private Claims

E6 Aug 10 1998


1. Stephan J. Szyszkoski

recovered, found as expressed below:

El2 Jul 13 1998 __, in a field survey on . do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented,

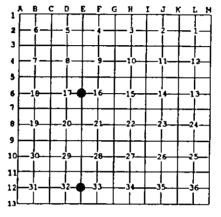

A. Description of original monument and accessories and/or subsequent restoration:

(E12) Quarter corner common to Sections 32-33. Corner established in 1852 by Zelotes B. Searles: "NS'E Corrected...39.99 Set quarter Section post. Y. Birch 22 SSW 23, Heml 12 NB2E B. Found no subsequent record.

(E6) Quarter corner common to Sections 16-17. Established in 1852 by Zelotes B. Searles: *40.00 Set quarter Section post. fir 4 \$23E B, do 3 N35W 20.° Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

(E12) Original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner midway and on a line of mean true bearing between Section corners 40,0480 ch. north and south. I observed the true bearing of this line to be MLB'19"E. At the position for the corner I placed a 1"IDx32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and mitnessed by D.Lampela and B.Wheeler, Baraga District Office. (E6) Original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner midway and on a line of mean true bearing between Section corners 39.831 chains north and south. At the position for the corner, I placed a 1° ID x 32° iron pipe capped with a 4° dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

(E12) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following: 8" Sugar N79E 35.1" "1/45 NBT" 15" Maple S22W 9.2' do 14" twin Hemlocks S67N 36.3' do 15" Sugar N39W 5.4" do Placed squared sugar post adjacent. Distances are to meas, notch. Bearings

are magnetic.

(E6) Set I' pipe with 4' MDNR cap. Blazed and scribed the following: 14" W. Spruce \$60E 17.0" "1/45 NBT" 8" Twin Maple S47E 20.9' ďo 7" Maple S41W 10.3" do 8" N. Spruce N56N 47.7" do Placed a squared spruce post adjacent. Bearings are magnetic. Distances are to meas. notch.

SF M/C STEPHAN J SZYSZKOSKI LAND SURVEYOR

Signed by 33980 Surveyor's Michigan License No.

For the Michigan Department of Matural Resources - Forest Management Division