

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

43.

For corners in

Iron	Located In:	Corner Code #
(County)		
1. Public Land Survey	T 46N R 34W	A7
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S 19 T 46N R 34W	3
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Aug 19 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:


(A7) Corner common to Sections 18-19 T46N-R34W and Sections 13-24 T46N-R35W. Corner restored May 2, 1969 by Donald O. Lappala, RLS 12585 as recorded in Liber 3 Page 184, Iron County Land Corner Records.
(3-Sec. 19) North 1/16 corner between Section 19, T46N-R34W and Section 24, T46N-R35W. Corner was not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(A7) Recovered the 1969 monument as described, in good condition, but leaning heavily in very unstable soil. The 1969 bearing trees were recovered in good condition. I plumbed the monument so as to put it in conformance with Lappala's two Cedar bearing trees. From this position, I measure 16.5' to the Black Spruce, not the 17.0' stated in the record. I accept the monument as a careful and faithful perpetuation of the position of the original corner and remeasure the 1969 witness tree and mark one new tree as described below. Corner recovered and re-witnessed by D.Lampala and B.Wheeler, Baraga District Office.
(3-Sec. 19) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a line of mean true bearing between Section corner 19.9572 ch. North and Quarter corner 19.9572 ch. South. At the position for the corner I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by D.Lampala and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(A7) Found 2" iron pipe with 3" dia. Bronze USFS tablet, appropriately stamped. The 1969 MBTs, fd. blazed and scribed: 10" Cedar N19E 26.6', 9" Cedar N77E 17.2, 7" B. Spruce S15E 16.5'. Blazed and scribed the following: Cedar S86E 15.8' "S19 NB1" Bearings are magnetic. Distances are to meas. notch.	(3) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following: 7" Cedar N65E 1.4' "1/16S BT" 12" Cedar S25W 20.15' do 7" Y. Birch N49W 24.9' do 10" Cedar N12W 3.6' do Placed a squared cedar post 2 ft. West. Distances are to meas. notch. Bearings are magnetic.
---	--

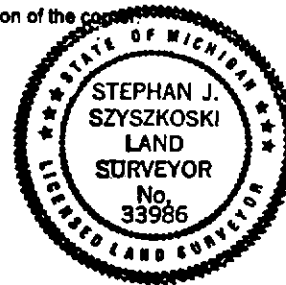

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 12/29/98

For the Michigan Department of Natural Resources - Forest Management Division