LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Iron Located In: Corner Code # 1. Public Land Survey 2. Property Controlling In Section 3. Miscellaneous Property in Sec.


Register of Deeds Stamp & File Number

, Recorded Plat 5. Private Claims

> Aug 11 1998 Jul 30 1998

I<u>, Stephan J. Szyszkoski</u> _, in a field survey on . 19 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformence with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded. on this certificate.

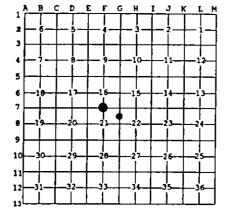

A. Description of original monument and accessories and/or subsequent restoration:

(F7) Quarter corner common to Sections 16-21. Corner restored in the original position by Dean C. DelaMater, RLS in 1951: "This corner was pointed out to me by George Divine, District Forester, of Crystal Falls. One original B.T. in place, in good condition. Corner was placed and witnessed August 16, 1951. Description of corner monument: 1° pipe with 4° brass cap. Witnesses to corner 14° H. Maple \$45E 63 links, 10" Spruce M75W 31 links".

(3-Sec. 22) Morth 1/16 corner between Sections 21-22. Corner was not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner;

(F7) Recovered the 1951 monument as described, a 1° I.D. iron pipe capped with a 4° dia. brass Michigan Dept. of Conservation tablet, in good condition, and at record bearing and distance from the 1951 witness trees, both in good condition. Found the remains of the original BT, at record bearing and distance, a large cedar (GLO record is Cedar 18 M22M 60), down, very rotted. face is all rotted out and no identifying marks were found. Left the monument in place and marked two new accessories as described below. Corner recovered and remitnessed by D.Lampela and B.Mheeler, Baraga District Office.

(3-Sec. 22) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a line of mean true bearing between Section corner 20.0167 chains north and Quarter corner 20.0167 chains south. At the position for the corner I placed a 1° I.D. x 32° iron pipe capped with a 4° dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the case

(F7) found 1" pipe with 4" brass cap. Blazed and scribed the following: "1/4S NBT" 12" Sugar \$35W 5.5' 10" Sugar N53E 29.0" da Distances above are to meas, notch. The 1951 NBTs: 19 Sugar \$42E 41.6 "1/45 NBT"

Blazed and scribed the following: 18° Y. Birch N25E 48.0° "1/165 BT" 18" Sugar \$80E 14.05' do 6' Sugar \$32E 10.15' do 8" Sugar N45M 19.95" da Placed a squared cedar post adjacent.

(3) Set 1° pipe with 4° MDNR cap.

Distances are to meas, notch. Bearings are magnetic.

OF MICH STEPHAN J SZYSZKOSKI LAND SURVEYOR

Distances to tree C/L. All bearings are magnetic. Placed squared post adjacent.

do

16" Spruce N67W 20.5"

Signed by 33986 Surveyor's Michigan License No.

for the Michigan Department of Matural Resources - Forest Management Division