

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Iron	Located in:	Corner Code #
(County)		
1. Public Land Survey	T 46N R 34W	16
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling In Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

Jul 29 1998

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													


A. Description of original monument and accessories and/or subsequent restoration:  
(16) Quarter corner common to Sections 14-15. Established in 1852 by Zelotes B. Searles: "S6'E Corrected...40.00 Set quarter Section post. Spruce 3 S84E 31, Tan 8 N16W 37...54.64 Intersect lake and set meander post...". Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(16) Original post and accessories were not recovered. Did not recover the meander corner or it's accessories on the north side of Spring Lake. Found no acceptable evidence of the position of the original corner on the ground. Extensive retracement reveals that the original survey was faithfully executed in this part of the township. I have observed a very small difference not only in measurement but frequently in bearing also. I note that the record bearing of the line between Sections 2-3, 10-11, and 14-15 is S6'E and I find S4.5'E between 12 and 15. Also, the N-S line a mile west checks similarly. Consequently I place great weight on the record and reestablish this corner using one point control. I reestablish this corner on a line between 12 and 15 produced to the south 40.0151 chains (the record 40 chains indexed to allow for the average observed difference) from 15. At the position for the corner, I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(16) Set 1" pipe with 4" MDNR cap.  
Blazed and scribed the following:  
4" 8. Spruce N33E 15.7' 1/4S MBT"  
6" 8. Spruce S17E 6.1' do  
5" 8. Spruce N84W 5.2' do  
5" 8. Spruce N23W 10.4' do  
Placed a 8. Spruce post adjacent.  
Bearings are magnetic. Distances are to meas. notch.

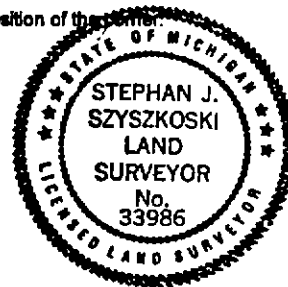

Signed by Stephan J. Szyszkoski Date 12/29/98  
Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division