

51.

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Iron _____	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>46N</u> R <u>34W</u>	<u>E4</u>
	T <u>46N</u> R <u>34W</u>	<u>H6</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling In Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

H6 Aug 24 1998

E4 Aug 10 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

(E4) Quarter corner common to Sections 8-9. Established in 1852 by Zelotes B. Searles: "40.00 Set quarter Section post. Heml 14 S47W 27. Fir 12 N40E 10". Found no subsequent record.

(H6) Center of Section 15. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(E4) Original post and accessories were not recovered. Found no evidence of prior monumentation. Found no acceptable evidence of the position of the original corner on the ground. Corner location is in a clearcut area. In the vicinity, there is a 14" W. Birch with a location poster (unidentified) and a single blaze, and an American Can Co. location poster on an 8" Maple. Posters indicate corner location to be SW approx 50' from the position monumented. I reestablish the corner midway and on a line of mean true bearing between Section corners 40.148 ch. north and south, being proportionate to the original record. At the position for the corner, I place a 1" ID x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by B.Wheeler and D.Lampela, Baraga District Office.

(H6) Found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite quarter corners. At the position for the corner, I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(E4) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:

7" Sugar N33E 41.7' "1/4S NBT"

7" Sugar S58E 50.6' do

10" Maple S51W 41.7' do

9" Balsam N51W 22.4' do

Placed a squared sugar post adjacent.

Bearings are magnetic. Distances to meas. notch.

(H6) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:

4" B. Spruce N26E 17.0' "C1/4 BT"


4" B. Spruce S23E 12.9' do

5" B. Spruce S45W 10.0' do

3" B. Spruce N10W 20.8' do

Placed a squared B. Spruce post adjacent. Bearings are magnetic.

Distances are to meas. notch.

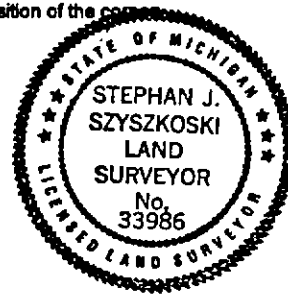

Signed by

Stephan J. Szyszkoski

Surveyor's Michigan License No.

33986

Date

12-29-98

For the Michigan Department of Natural Resources - Forest Management Division