LAND CORNER RECORDATION CERTIFICATE 1970

Located In:	Corner Code #	
T <u>46N</u> R T R	34H	
S TR S TR S TR		
	T 46H R T 46H R T R T R S T R S T R	T 46M R 34N 63 T 46N R 34N


Register of Deeds Stamp & File Number

4. Lot No, 5. Private Claims	Recorded Plat		
•		F6	Aug 26 1998

<u>, Stephan J. Szyszkoski</u> _, in a field survey on 19 _ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

G3 Aug 25 1998

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

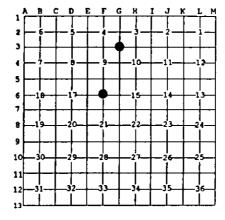

A. Description of original monument and accessories and/or subsequent restoration:

(63) Corner common to Sections 3-4-9-10. Established in 1852 by Zelotes B. Searles: "S6'M Corrected...78.70 Set post Cor. Secs. 3,4,9,10. Spruce 3 S44E 25, Cedar 8 MSOM 17". Aug. 24, 1954 record by B.G. Buell for Morthern Paper Mills at Ned Lake Land and Timber Co. state: "1930 Jacobson and R.Sillers found Ced. 8 M50W 17 I.M. plain. Aug. 1954 S. Mickean and J.Peryam found post. Ho evidence of original 8.T. set pipe at post. Description of corner monument: Iron pipe and Brass cap. Witnesses: Ced. 8 M35E 30 lks., Ced. 8 S54W 25 lks." found no subsequent record.

(F6) Center of Section 16. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

(G3) Recovered the 1954 monument, as described, a 1" ID iron ipe capped with a 2" dia. brass tablet stamped "NORTHERM PAPER MILLS", in good condition, and at record bearing and distance from the remaining 1954 witness Cedar ME. The Cedar SN appears to have fallen over. found an old squared post adjacent to the monument. The original 8T's were not recovered. Although not it is not stated so in the 1954 record, I assumethat the monument was placed at the position recovered in 1930. Distances West and South to probable original corners are 79.998 ch. (80.07R) and 40.169 ch. (40R) respectively. I accept the monument as a careful and faithful perpetuation of the position of the original corner. Left the monument in place and marked 3 new accessories as described below. Corner recovered and rewitnessed by D.Lampela and B.Mheeler, Baraga District Office.

(F6) Found no evidence of prior aconumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite quarter corners. At the position for the corner, I placed a 1° IO x 32° iron pipe capped with a 4° dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and mitnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and	accessories established to perpetuate locating the p	position of the Berner.
(G3) Found i iron pipe with NPM cap.	(F6) Set 1" pipe with 4" HDNR cap.	104
Blazed and scribed the following:	Blazed and scribed the following:	
7" Cedar \$47E 22.9' "\$10 H8T"	4" B. Spruce N35M 15.8"	★ STEPHAN J.
8" Cedar \$40M 18.8' "\$9 N8T"	5° 8. Spruce \$48E 33.3'	SZYSZKOSKI
11° Cedar N47N 24.3' "S4 NBT"	5" B. Spruce S21E 16.6"	LAND #
The 1954 witness:	5" B. Spruce \$48W 30.85'	SURVEYOR /
9" Cedar M39E 19.8' Fd. scribed "S3 BT"	Placed a squared cedar post adjacent.	No. S
Bearings are magnetic. Distances to	Bearings are magnetic. Distances are to	33986
meas. notch.	meas. notch.	AND SU
		William Control

33986