LAND CORNER RECORDATION CERTIFICATE A 1970


For corners in	Filing Requirement of Act 74, Mich. P.		
Iron	Located In:	Corner Code #	
(County)	•		
1. Public Land Survey	T <u>46#</u> F T <u>46#</u> F T F	R	
Property Controlling In Section Miscellaneous Property in Sec.	S TF S TF S TR		
4. Lot No, Records. Private Claims	ded Plat		

Register of Deeds Stamp & File Number

Aug 10 1998

I, Stephan J. Szyszkoski , in a field survey on . 19 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Burseu of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate

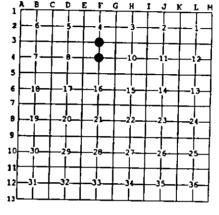

A. Description of original monument and accessories and/or subsequent restoration:

(F3) Quarter corner common to Sections 4-9. Established in 1852 by Zelotes 8. Searles: "S89 deg. 41'W Corrected... 40.03 1/2 Set post quarter Sec. Tam 4 \$40M 13, Cedar 4 N27E 5". Found no subsequent record.

(F4) Center of Section 9. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(F3) Original post and accessories were not recovered. Found no evidence of prior monumentation at the corner position. Found no acceptable evidence of the position of the original corner on the ground. Found several blazed cedars in the area, including one with a Morthern Paper Mills tag marked "about 1/4" which seems to mark an approximate corner. Reestablished the corner midway and on a line of mean true bearing between monumented corners 39.9989 ch. East and Mest, being proportionate to the original record. I observed the true bearing of this line as S89 deg. 37'54"M. At the position for the corner I placed a 1" ID x 60° iron pipe capped with a 4" dia. cast aluminum MDMR tablet, appropriately stamped. Corner placed and mitnessed by 8. Wheeler and D. Lampela, Baraga District Office. (F4) Found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite quarter corners. At the position for the corner I placed a 1° IO x 32° iron pipe capped with a 4° dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and mitnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and a (F3) Set 1" pipe with 4" MONR cap. Blazed and scribed the following: 12" Cedar M85E 15.2' "1/4S MBT" 8" Cedar M64N 36.5' "1/4S MBT" 8" Cedar (leaning) M39E 50.6' do 7" Bl. Ash S45N 22.5' "1/4S MBT" Placed a squared cedar post adjacent. Distances are to meas. notch. Bearings are magnetic.	(F4) Set 1° pipe with 4° MDHR cap. Blazed and scribed the following: 6° B. Spruce M24E 29.7' "C1/4S BT" 8° B. Spruce S7IE 24.0' do 8° B. Spruce S38M 19.1' do 6° B. Spruce M57M 16.2' do Placed a squared B. Spruce post adjacent. Bearings are magnetic. Distances are to meas. notch.	STEPHAN J. SZYSZKOSKI LAND SURVEYOR No. 33986
--	---	---