

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Iron	Located In:	Corner Code #	
(County)			
1. Public Land Survey	T 46N R 34W	H11	
	T R		
	T R		
	T R		
2. Property Controlling in Section	S T R		
	S T R		
3. Miscellaneous Property in Sec.	S T R		
	S T R		

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Jul 14 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 20____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	10	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													


A. Description of original monument and accessories and/or subsequent restoration:
 Quarter corner common to Sections 27 & 34. 1852: Established by L.B. Searles: S89-25W Corrected... 40.06 Set quarter Sec. post top of ridge 40 ft. C N&S. W.Pine 24 S60E 25, W.Pine 36 N55W 10...80.12 Section corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

Recovered an old rotting post point at record bearing and distance from the remains of the two original W.Pine bearing trees, now both rotting stumps, of proper size, with no markings visible. Distance east to probable original corner is 40.01 ch. Distance west to reestablished corner is 40.09 ch. Accepted the post point as the position of the original corner and replaced it with a monument described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

Set 1" ID I. pipe with 4" MDNR cap.
 Blazed and scribed:
 14" triple Sugar N39E 19.3' "1/4S N8T"
 12" Maple S76E 13.2' do
 10" Sugar S41W 22.65' do
 14" Sugar N78W 8.55' do
 Bearings are magnetic. Distances are to notch in lower blaze.

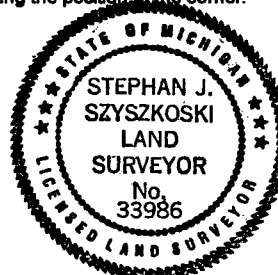

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 4/15/02