

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

<u>Iron</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>46N</u> R <u>34W</u>	<u>L5</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u>24</u> T <u>46N</u> R <u>34W</u>	<u>L8</u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

Register of Deeds Stamp & File
Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims

I, Stephan J. Szyszkoski, in a field survey on Sept. 12, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5												●	
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		●	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(L5) Quarter corner common to Sections 12 and 13. 1852 - Established by Z.B.Searls, Deputy Surveyor, midway and on the Section line between Section corners 40.095 chains east and west. Set post. Cedar 14 S43W 31 links, Cedar 8 N05E 13 links. Found no subsequent record.

(L8) Center of Section 24. Not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(L5) The original post and accessories were not recovered. Found no evidence of the position of the original corner on the ground. Reestablished the corner by single proportionate measurement to the original record, midway and on the Section line between Section corners 2635.01' east and west. The corner position falls in an alder swamp.


(L8) Established the corner at the intersection of straight lines connecting opposite 1/4 corners.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(L5) Set 1"IDx32" I.pipe with 4" alum. MDNR cap.
 Set measuring nail with MDNR tag in:
 6" Tamarack S31E 31.0' mrkd "1/4S NBT"
 6" Tamarack S54E 27.9' do
 11" Spruce N49E 19.7' do
 8" Balsam N25W 34.4' do
 Set sq'd cedar post adjacent. Brgs are magnetic.
 Dist. are to nail with tag in the side of tree.

(L8) Set 1"IDx32" I.pipe with 4" alum. MDNR cap.
 Set measuring nail with MDNR tag in:
 4" Sugar N70E 14.3' mrkd "C1/4 BT"
 4" Spruce S23E 9.6' do
 6" Spruce S26W 18.7' do
 4" Spruce N40W 16.2' do
 Set sq'd spruce post adjacent. Brgs are magnetic.
 Dist. are to nail with tag in the side of tree.

Signed by Stephan J. Szyszkoski

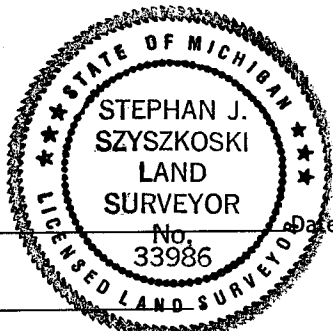

Date 11/6/07

Surveyor's Michigan License No. 33986