

FEB 26 1999

JACKSON COUNTY APPROVED LAND CORNER P.A. 343 of 1990

Chairman [Signature] West 1/4 Corner of Section 32, Napoleon Township LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in JACKSON (County)

Located In:

Corner Code /



2295595 Page: 1 of 1 11/20/1999 03:25P L-1586 P-913

- 1. Public Land Survey T3S R2E C-12
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R
4. Lot No. Recorded Plat
5. Private Claims

Register of Deeds Stamp & File Number

Table with 13 rows and 12 columns (A-M) containing numbers 1-36. Cell 12,32 contains a black dot.

I, David E. Erickson, in a field survey on May 30, 19 97, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Around 1824, H. Parke - Deputy Surveyor, reported the corner as "Set Post" and recorded two witnesses: "B. Oak 20, S34 1/2°E, 4 1/2" (2.97') and "W. Oak 10, N50°W, 4" (2.64').

In the late 1800s, the Remonumentation Surveyor reported "Corner gone - Ran transit line and at 40.00 ch found remains of both Gov't Witnesses - Set post accordingly." and recorded two witnesses: "W. Oak 26, S75 1/2°W, 33" (21.78'), "W. Oak 22, S66 1/4°E, 51 1/2" (40.59').

This corner not recorded under Public Act #74.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Found bottom 12" of Fire Clay (FC) on West side of fence post. A 4 foot long x 1" flat iron is 0.45 feet Northeast. A capped iron #7863 is on the East side of FC. Fence runs East. Accepted found FC as a careful and faithful perpetuation of the original corner. Replaced FC with a standard Jackson County concrete monument. Buried FC on North side of monument, flat iron on East side and capped iron on South side of monument.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 4" x 36" concrete monument with metal rod and standard aluminum cap stamped "C-12, T3S-R2E, 1997, LS #29245".

- N 17° E Set nail and tag #29245, Northwest side 18" Oak 34.36'
N 55° E Set nail and tag #29245, Southeast side 20" Beech 60.93'
South Set nail and tag #29245, East side 28" Oak 10.73'
S 64° W Set nail and tag #29245, Southeast side 18" Hickory 48.53'
East County Surveyor sign post 0.5'

NOTE: Bearings are magnetic.

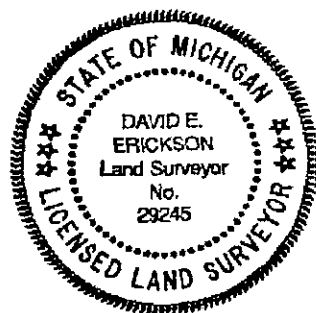

Signed by [Signature] Date 11-18-98

Surveyor's Michigan License No. 29245