

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>25</u> N. <u>8.</u> , R. <u>6</u> E. <u>W.</u>	<u>F-1; G-1; H-1</u>
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ S., R. _____ E. _____ W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ S., R. _____ E. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 2-5 1973, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:~~

H-1

M. Schaaf, Deceased Dept. Surveyor restored this corner Aug 1939 per U.S. W.P. B.T. stump tipped over and US N.E. BT Site. Schaaf notes indicate Cons. Power corner (Fargo) is about 75 links South & 25 links West of proper corner. We recovered Schaaf position for corner from his three W.P. stump wit. and noted the tipped over W.P. stump. We also recovered Cons. Power pipe (Fargo 1913) there being no lines of occupancy from either corner position. We accepted Schaaf position for proper 1/4 corner (Set DNR Mon.) because Fargo corners by single proportion as set along the North line of Secs. 3 & 4 are in error by approx. two chains. Fargo NE to N $\frac{1}{4}$ Sec. 3 shows 2662.4' - we compute 2670'±. Fargo N $\frac{1}{4}$ to NW Sec. 3 shows 2662.4' - we compute 2591'±.

F-1

The N $\frac{1}{4}$ corner of Sec. 4 was erroneously established by Fargo in 1913 and has since been accepted by land owners and used by private surveyors to establish the center of Sec. 4. We have accepted Fargo corner as occupied, since the Govt corner is a lost corner. Also see Item B. N $\frac{1}{4}$ cor. Sec. 3., and Item B. W $\frac{1}{4}$ corner Sec. 3.

G-1

Reestablished Sec. corner by single proportion to U.S. between the N $\frac{1}{4}$ corner Sec. 3 (Schaaf) and the N $\frac{1}{4}$ cor. of Section 4 (Fargo). Could not accept Fargo pipe (not used in recent years). See Item B. N $\frac{1}{4}$ cor. Sec. 3, T25N-R6W.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-1	G-1	H-1
Fd. Fargo Pipe, Conc. Mon & Rerod. Set Cedar Gd. Post w/loc tag	Set DNR Mon & Cedar Gd Post	Set DNR Mon & Ced. Gd. Post
4" Balsam S59E 71.4'	4" Balsam Due S 57.40'	16" W.Pine N24W 24.1
7" Balsam S22E 76.5'	6" Balsam S79E 130.60	14" W.Pine N36E 22.5
10" Maple Cistr N46W 103.2' (3)	12" Balsam N14W 103.20	12" Cedar S70E 60.3
Dirt Rd. N-S Due W 16.5'	Fd 3/4" Fargo Pipe buried S45°53'E 37.9	16" W.Pine S18W 40.4
		Fd. 3/4" Fargo Pipe S17°16'W 55.9
		E-W Rand. Due S 50'


SIGNED BY Carl F. Roser DATE 6-15-73

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

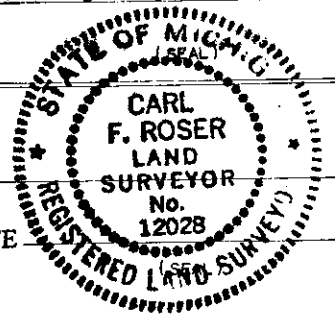

SURVEYOR'S MICHIGAN REGISTRATION NO. _____