

**SURVEY &
REMONUMENTATION**

JAN 21 1998

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Keweenaw
(County)

Located In: Corner Code #

- 1. Public Land Survey

T	58N	R	29W	MC 18
T	58N	R	29W	H-13
T		R		
T		R		
- 2. Property Controlling in Section

S		T		
S		T		
- 3. Miscellaneous Property in Sec.

S		T		
S		T		
- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

REGISTER'S OFFICE

County of Keweenaw } SS
 Received for Record on 30th
 day of December A.D. 1997
 at 10:00 o'clock AM and Recorded
 in Liber 181 of LCR
 on page 181
James C. Carlisle, Deputy
 Register of Deeds

Register of Deeds Stamp & File Number

I, John Haataja, in a field survey on 11/7, 1997
 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
 in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the
 current manual of survey instructions of the United States Department of the Interior, Bureau of Land
 Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
 Court of Law; established, re-established, monumented, re-monumented, recovered, found as
 expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	8	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

MC 18 Wood post set in 1847
 Spruce 6" N49°E 10LKS

H-13 Wood post set in 1847
 W. Pine 12" N60°E 17 LKS
 W. Pine 9" S30°W 98 LKS

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

MC 18 No evidence of original corner found.
 Set MC on South section line of Section 34 at high watermark.


H-13 S $\frac{1}{4}$ corner was reestablished in 1990.
 and recorded in LCR 1, Page 87,
 Keweenaw County Records. Corner was
 reestablished as called for in
 description of U.S. Lighthouse Parcel.

Ratified by Peer Group
 In accordance with P.A. 345
 Co. Rep. [Signature]
 Date 10/15/97

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

MC 18 Set 1" pipe with brass cap.
 16" W. Pine N20°W 63.95'
 18" W. Pine N24°E 44.07'
 16" W. Pine S86°E 40.80'
 18" W. Pine S01°W 22.00'

H-13 Set 1" pipe with brass cap
 15" R. Pine N02°E 17.00'
 9" W. Pine S67°E 6.99'
 15" W. Pine S15°E 23.04'
 24" W. Pine N82°W 11.45'

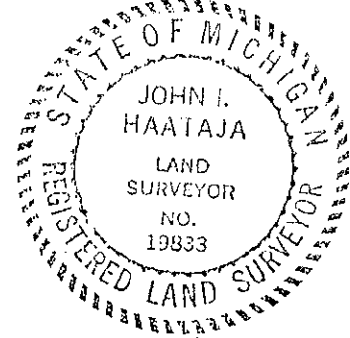

Signed by [Signature]
 Surveyor's Michigan License No. 19833

Date 12/30/1997