

MAY 16 1997

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Table with columns: Lake (County), Located In, Corner Code #. Includes entries for Public Land Survey, Property Controlling in Section, and Miscellaneous Property in Sec.

LIBER 003 PAGE 0356

REGISTERED LAKE COUNTY, MI. SEP 12 3 09 PM 1996 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

Grid table with columns A-M and rows 2-13. Contains numerical data for recording purposes.

Robert L. Wetherell August 7, 1996

I, in a field survey on do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration.

- 1837 - J. Hodgson, G.L.O. #1 - 16" Hemlock S50°W 18 Links #2 - 7" Hemlock N47°W 38 Links
1916 - George Johnson, Co. Sur. At 2626 North of Sec. Cor. found Gov't Trees and old stake. 1-1/4" Pipe 3 feet long. #3 - 10" Hemlock N48°W 25.5' #4 - 8" W. Pine S85°30'W 26.6' #5 - 8" Y. Pine S77°30'E 16.5'
1966 - George Blass, LS 5489 Found 1/2" Gal. Pipe replaced with Concrete Monument #6 - 21" W. Pine N59°W 52.13' #7 - 19" W. Pine S53°30'W 61.00'
1975 - Clinton Cole, LS 17615 Survey recorded in Liber 02, Page 127 Accessories same as 1966 Blass

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


I found a 4" x 36" concrete monument badly damaged 47 feet West of the centerline of North and South Steel Tower Line in line with old fence to East.
Condition of accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Gone, #5 Gone, #6 Found in good condition, #7 Found in good condition, (should be Red Pine).

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP IN ACCORDANCE WITH P.A. 345 CHAIRMAN DATE - 8-27-96 Q.L.W

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-8 & A-8 - 1/4 Cor. Sec. 24, T17N, R12W & 1/4 Cor. Sec. 19, T17N, R11W, Lake Co., Mi.
I replaced the Concrete Monument with a 3/4" x 24" re-bar with Lake County Brass Lake, and is accepted as a careful and faithful re-establishment of the position of the original corner.
30" W. Pine N56°W 51.58' (60d spike in S. side) #6
18" R. Pine S56°W 61.20' (60d spike in S. side) #7
14" Tw. R. Oak N86°E 108.17' (60d spike in S. side)
10" Tamarack S53°E 114.90' (60d spike in N. side)

Signed by Robert L. Wetherell Date August 28, 1996
24624

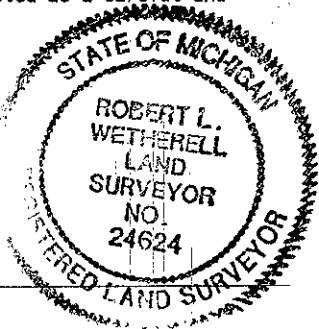

Surveyor's Michigan License No. 24624