

NOV 21 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED
LAKE COUNTY, MI.
LIBER 004 PAGE 004 1
SEP 12 10 31 AM '97


For corners in

Table with columns: Lake (County), Located In: (17N, 13W), Corner Code # (E-5). Rows include Public Land Survey, Property Controlling in Section, and Miscellaneous Property in Sec.

REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

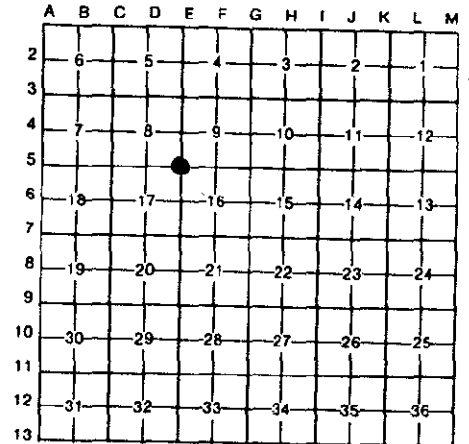

Robert L. Wetherell July 2, 97
I, in a field survey on 19 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

E-5 - Section corner common to Sections 8, 9, 16 & 17, T17N, R13W, Lake Co., Mi.

- 1838 - J. Hodgson, G.L.O. Undated - Co. Sur. Records 1972 - Robert Griffin, LS 13584
#1 - 8" Pine S98°W 45 Links (?) #6 - 10" J. Pine N36°E 70.0' Found Iron Housing (Axle) replaced with Concrete Monument
#2 - 6' Pine N60°E 59 Links #7 - 10" B. Oak S78°E 55.4'
1931 - George Johnson, Co. Sur. 1941- George Blass, LS 5489
2" Iron Found Cast Iron Housing
#3 - 10" B. Oak S88°E 64' #4 - 14" B. Oak N60°W 72.70' #8 - 13" J. Pine N65°E 27.22'
#4 - 8" B. Oak N60°W 73' #3 - 16" B. Oak - East 64.00' #9 - 5" J. Pine S36°E 58.21'
#5 - 6" W. Oak N30°15'E 106' #8 - 10" J. Pine N65°E 26.70' #10 - 1/2" Pipe S25°W 72.90'
#11 - 2" W. Pine N50°W 66.57'
#12 - Post - East 32.95'

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-5 - Section corner common to Sections 8, 9, 16 & 17, T17N, R13W, Lake Co., Mi.

I found a 5" Square Concrete Monument 6 feet North of intersection of roads north, South and West.

Condition of the accessories are as follows: #1 Gone, #2 gone, #3 Found Stump, #4 Found in poor condition, #5 Found in good condition, #6 Gone, #7 Gone, #8 Found dead, #9 Found in good condition, #10 Found in good condition, #11 Found in good condition, #12 Found in good condition.

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP IN ACCORDANCE WITH P.A. 345

CHAIRMAN R.L.W.
DATE 8-27-97

Description of monument for corner and accessories established to perpetuate locating the position of the corner:


E-5 - Section corner common to Sections 8, 9, 16 & 17, T17N, R13W, Lake Co., Mi.

I accepted the 5" Square Concrete Monument as a substantial marker for the corner, and is accepted as a careful and faithful re-establishment of the position of the original corner.

- 16" W. Oak N35°E 106.98' (60d spike in E. side) #5
8" W. Oak S75°E 49.98' (60d spike in N. side)
8" J. Pine S31°E 58.13' (dock spike in E. side) #9
9" W. Oak S48°W 71.94' (60d spike in S.E. side)

Witnessed by Robert L. Wetherell
24624

Date 8-27-97

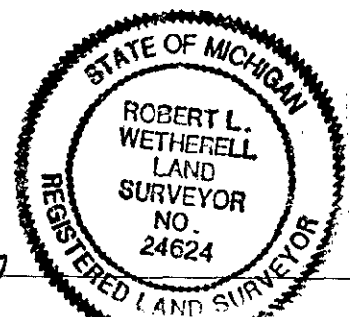

Surveyor's Michigan License No.