

**JAN 25 2001**

**LAND CORNER RECORDATION CERTIFICATE**

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

**SECTION**

For corners in Lake _____	Located in:	Corner Code#
1. Public Land Survey	T 17 N R 14 W	C-2
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. _____ Recorded Plat _____		
5. Private Claims _____		

RECORDED  
LAKE COUNTY, MI.  
LIBER 004 PAGE 0250

MAY 5 10 27 AM '00

*Shelley Myers*  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Robert L. Wetherell, in a field survey on March 10, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

C-2 - 1/4 Corner common to Sections 5 & 6, T17N, R14W

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6	5			4		3		2		1	
3													
4		7	8			9		10		11		12	
5													
6		18	17			16		15		14		13	
7													
8		19	20			21		22		23		24	
9													
10		30	29			28		27		26		25	
11													
12		31	32			33		34		35		36	
13													

**A. Description of original monument and accessories and/or subsequent restoration:**

1838 - J. Hodgson, G.L.O.

#1 - 10" Beech S71°W 22 Links  
#2 - 8" Beech N35°E 30 Links

1914 - G.H. Johnson, Co. Sur.

Well Point  
#3 - 40" Pine Stump N11°E 212 Links  
#4 - Gray Stone 3' diameter West 44 Links

1979 - C. Cole, LS 17615

"Found pipe in centerline of road".  
Raised to surface with 1/2" rebar.  
#5 - 8" B. Oak N86°E 75.51'  
#6 - P. Pole N28°E 78.32'

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

I found a 1/2" Capped Iron (Cole's - LS 17615) in the centerline of North and South road and in line with old fence to the East. Directly below the 1/2" Iron (approximately 40" deep) I found the old well point and wood stake by Johnson.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Gone, #5 Found in good condition, #6 gone.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

I replaced the 1/2" Iron with a 3/4" rebar with Lake County Remon Cap, and is accepted as a careful and faithful reestablishment of the position of the original corner.

P. Pole N68°E 36.28' (Nail S. side)  
6" W. Pine S50°E 66.85' (60d spike N. side)  
14" W. Pine N48°E 90.32' (60d spike S. side)  
14" Tw. B. Oak N87°E 75.20' (60d spike N. side) #5

VALIDATED BY THE LAKE CO. PEER REVIEW GROUP  
IN ACCORDANCE WITH P.A. 345  
CHAIRMAN *C.L.W.*  
DATE *4-11-2000*

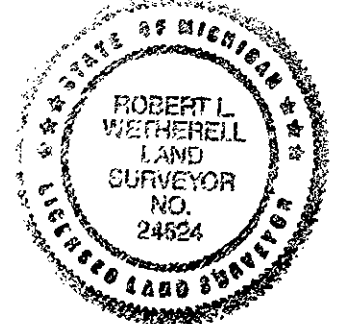

Signed by Robert L. Wetherell  
Surveyor's Michigan License No. 24624

Date April 12, 2000