

REMONUM

NOV 21 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970.

RECORDED LAKE COUNTY, MI. LIBER 004 PAGE 0042 SEP 12 10 31 AM '97

REGISTER OF DEEDS

For corners in

Table with columns: Lake (County), Located In: (17N, 14W), Corner Code # (I-3). Rows include Public Land Survey, Property Controlling in Section, and Miscellaneous Property in Sec.

Register of Deeds Stamp & File Number

- 4. Lot No. , Recorded Plat
5. Private Claims

Robert L. Wetherell July 2, 97

I, in a field survey on 19 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


I-3 - Section corner common to Sections 2, 3, 10 & 11, T17N, R14W, Lake Co., Mi.

1838 - John Hodgson, G.L.O. #1 - 6" Cherry N39°E 13 Links #2 - 6" Maple S45°W 13 Links

1915 - George Johnson, Co. Surveyor Old Axe and Iron for Corner #3 - 10" B. Oak S12°30'W 105 Links #4 - 6" Pine N39°W 72 Links

Undated - George Johnson, Co. Surveyor #5 - 20" W. Pine S33°30'E 52'

(See over for continuation of "A")

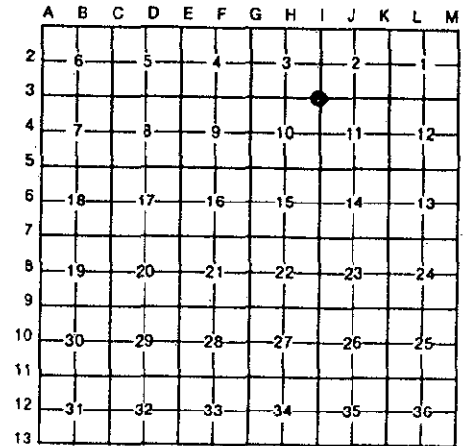

3. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-3 - Section corner common to Sections 2, 3, 10 & 11, T17N, R14W, Lake Co., Mi.

I found a 10" Dock Spike directly over a 5" Square Concrete Monument in the intersection of roads North, South East and West.

Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Gone, #5 Found in good condition, #6 Gone, #7 Found in good condition, #8 Gone, #9 Found in good condition, #10 Found in good condition, #11 Found in good condition, #12 Found in good condition, #13 Replaced.


RATIFIED BY THE LAKE CO. PEER REVIEW GROUP IN ACCORDANCE WITH P.A. 345 CHAIRMAN R.T.W. DATE 8-27-97

2. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-3 - Section corner common to Sections 2, 3, 10 & 11, T17N, R14W, Lake Co., Mi.

I accepted the 5" Concrete Monument as a substantial marker for the corner, and is accepted as a careful and faithful re-establishment of the position of the original corner.

P. Pole N25°W 81.74' (P.K. Nail i E. side) 22" W. Pine N42°W 64.28' (60d spike in E. side) #7 38" W. Pine S34°E 52.5' (60d spike in W. side) #5 8" W. Pine S49°W 70.15' (60d spike in S.E. side)

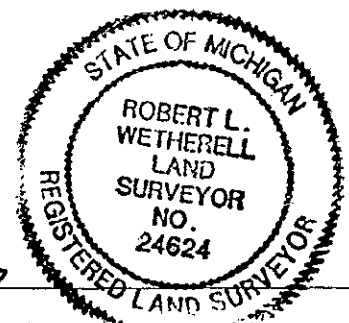

igned by Robert L. Wetherell 24624

Date 8-27-97

urveyor's Michigan License No.

CONTINUATION OF "A" - DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

1945 - George Blass, LS 5489

Found Old Axe and Cant Hook with stones. Set square stake with Boat Spike in top.

#5 - 30" W. Pine S33°E 52.5'

#6 - 12" Elm N18°E 59.6'

#7 - 14" W. Pine N45°W 64.0'

#8 - 16" Elm N59°E 92.95'

#9 - 8" B. Oak S55°W 62.21'

1964 - Robert Griffin, LS 13584

L.C.R.C. - Liber 01, Pg. 44

Found Boat Spike and replaced with

5" x 36" Concrete Monument

#10 - 12" W. Pine N32°E 134.94'

5 - 30" W. Pine S34°E 53.19'

#11 - Cedar Post S45°W 46.7'

#12 - 13" W. Pine S46°W 116.14'

7 - 21" W. Pine N42°W 64.44'

#13 - P. Pole N32°W 81.10'

1986 - Clinton E. Cole, LS 17615

Survey recorded in Liber 03, Pg. 66

U.S.F.S. Monument

Witnesses the same as Griffin's