

SURVEY & REMONUMENTATION

AUG 31 1999 LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

RECORDED
LAKE COUNTY, MI.

SECTION

LIBER 004 PAGE 0199

JUL 23 3 04 PM '99

Shirley H. Dechant
REGISTER OF DEEDS

For corners in Lake	Located in:	Corner Code#
1. Public Land Survey	T18N	R12W I-2
	T	R
	T	R
	T	R
2. Property Controlling in Section	T	R
	S	T R
3. Miscellaneous Property in Sec.	S	T R
	S	T R
4. Lot No. Recorded Plat		
5. Private Claims		

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on February 2, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

I-2 - 1/4 Corner common to Sections 2 & 3, T18N, R12W

A. Description of original monument and accessories and/or subsequent restoration:

1838 - J. Hodgson, G.L.O.
#1 - 7" W. Oak S16°W 10 Links
#2 - 7" W. Oak N18°W 12 Links

1991 - R.L. Wetherell, LS 24624
L.C.R.C. - L. 03, Pg. 119
"Set corner by single proportionate method in clear cut".
(1/2" Capped Iron)
#3 - 16" B. Oak N73°E 31.12'
#4 - 12" W. Oak N46°E 46.48'

B. Description of corner evidence found and/or method applied in restoring of reestablishing corner:

I found the 1/2" capped iron I set in 1991 in a thick clear cut. I traversed the East line of Section 3 to Check if corner was in proper location as set in 1991, verified it's correct location.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Found in good condition #4 Found in good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced the 1/2" iron with a 3/4" x 24" re-bar with Lake Co. Remon Cap, and is accepted as a careful and faithful re-establishment of the position of the original corner.

18" B. Oak N73°E 31.12' (60d spike in N. side)
14" W. Oak N46°E 46.48' (60d spike in N.W. side)
20" R. Oak - Due South 131.67' (60d spike in E. side)
N.E. Cor. Sec. 3 - N0°20'32"E 2594.42'
S.E. Cor. Sec. 3 - S0°20'32"W 2618.62'

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP
IN ACCORDANCE WITH P.A. 345
CHAIRMAN *R.L.W.*
DATE *7-20-99*

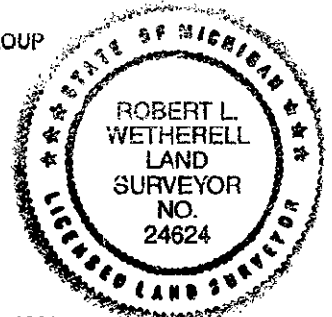

Signed by *Robert L. Wetherell*

Date July 21, 1999

Surveyor's Michigan License No. 24624