

JAN 25 2001

SECTION LAND CORNER RECORDATION CERTIFICATE
 FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

For corners in _____
 Lake _____

Located in: _____ Corner Code# _____

1. Public Land Survey T 18 N R 14 W I-7
 T R
 T R
 T R

2. Property Controlling S T R
 in Section S T R

3. Miscellaneous S T R
 Property in Sec. S T R

4. Lot No. _____ Recorded Plat _____

5. Private Claims _____

RECORDED
 LAKE COUNTY, MI
 LIBER 004 PAGE 0260

MAY 5 10 28 AM '00

Shelley Myers
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on February 15, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

I-7 - Sec. corner common to Sections 14, 15, 22 & 23, T18N, R14W

A. Description of original monument and accessories and/or subsequent restoration:

1838 - S. Sibley, G.L.O.
 #1 - 10" W. Oak S7°E 19 Links
 #2 8" W. Oak N69°W 15 Links

1964 - R.A. Griffin, LS 13584
 L.C.R.C. - Liber 01, Pg. 126
 Set corner from recovered accessories by G.H. Johnson.

1991 - R.L. Wetherell, LS 24624
 Same witnesses as Griffin's

1926 G. H. Johnson, Co. Sur.
 #3 - 5" B. Oak S.W. 94.5'
 #4 - 6" B. Oak N.E. 65.5'

Set 5" Square Concrete Monument
 #8 - 5" Maple N26°E 85.63'
 #4 - 12" R. Oak N53°E 65.50'
 #9 - 2" Maple S17°E 88.07'
 #10 - 6" R. Oak S56°W 144.15'
 #11 - 5" Maple N43°W 114.50'
 #12 - Stone - North 38.11'

1926 - L. Davis, M.S.H.D.
 1" Iron Pipe
 #5 - 6" Oak S35°E 24.3'
 #6 - 6" Oak S14°30'W 30.1'
 #7 - 8" Oak N41°W 47.8'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found Griffin's 5" Square Concrete Monument 23.5 feet North of painted centerline of Highway U.S. 10. I also found a 1-½" pipe along side the monument.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Found in poor condition, #5 Gone, #6 Gone, #7 Gone, #8 Found in good condition, #9 Found in good condition, #10 Found dead, #11 Gone, #12 Found in good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I accepted the 5" Square Concrete Monument as a substantial marker for the corner, and is accepted as a careful and faithful reestablishment of the position of the original corner.

- 10" Maple S15°E 87.99' (dock spike in E. side)
- 15" R. Oak N07°W 36.18' (60d spike in E. side)
- 16" R. Oak N55°E 65.89' (60d spike in S. side) (dying)
- 10" Maple S14°W 82.82' (60d spike in E. side)
- "X" on Stone North 38.11'

RATIFIED BY T.L. & CO. DESIGN REVIEW GROUP
 IN ACCORDANCE WITH P.A. 345
 CHAIRMAN R.L.W.
 DATE 4-11-2000

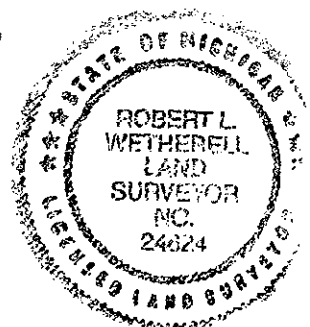

Signed by Robert L. Wetherell
 Surveyor's Michigan License No. 24624

Date April 12, 2000