

AUG 31 1999

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

SECTION

RECORDED LAKE COUNTY, MI. LIBER 004 PAGE 0218

JUL 23 3 07 PM '99

REGISTER OF DEEDS

Form with fields: For corners in Lake, Located in, Corner Code#, 1. Public Land Survey, 2. Property Controlling in Section, 3. Miscellaneous Property in Sec., 4. Lot No. Recorded Plat, 5. Private Claims

Register of Deeds Stamp & File Number

Grid table with columns A-M and rows 1-13

I, Robert L. Wetherell, in a field survey on January 25, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

J-7 - 1/4 Corner common to Sections 14 & 23, T18N, R14W

A. Description of original monument and accessories and/or subsequent restoration:

1838 - S. Sibley, G.L.O. #1 - 8" Pine N61°E 10 Links #2 - 8" Pine S8°W 27 Links

1991 - R.L. Wetherell, LS 24624 L.C.R.C. - L. 03, Pg. 118 Set on line between N.W. corner and N.E. corner at a distance from N.W. corner that fits occupation at the West 1/16 corner position. #3 - 22" W. Oak S2°W 102.32' #4 - P. Pole S21°E 126.69' #5 - 10" W. Oak N51°E 84.75' #6 - 10" W. Oak N13°W 75.91'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found the 1/2" Capped re-bar I set in 1991. Corner is 36.5' North of the centerline of U.S. - 10.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3, Found in good condition, #4 Found in good condition, #5 Found in good condition, #6 Found in good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced the 1/2" rod with a 3/4" x 24" re-bar with Lake County Remon Cap, and is accepted as a careful and faithful re-establishment of the position of the original corner.

20" W. Oak S2°W 102.32' (60d spike in W. side) #3 P. Pole S21°E 126.69' (60d spike in E. side) #4 10" W. Oak N51°E 84.75' (60d spike in N.W. side) #5 11" W. Oak N13°W 75.91' (60d spike in E. side) #6

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP IN ACCORDANCE WITH P.A. 345 CHAIRMAN R.L.W. DATE 7-20-99

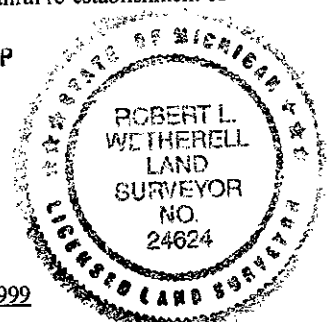

Signed by Robert L. Wetherell

Date July 21, 1999

Surveyor's Michigan License No. 24624