

**SURVEY & REMONUMENTATION**

**AUG 31 1999**

**LAND CORNER RECORDATION CERTIFICATE**

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

**SECTION**

RECORDED  
LAKE COUNTY, MI.  
LIBER 004 PAGE 0216  
JUL 23 3 06 PM '99

*Shirley H. Dechant*  
REGISTER OF DEEDS

For corners in Lake _____	Located in:	Corner Code#	
1. Public Land Survey	T 18N	R 14W	K-8
	T	R	
	T	R	
	T	R	
2. Property Controlling S in Section	T	R	
	S T	R	
3. Miscellaneous Property in Sec.	S T	R	
	S T	R	
4. Lot No. _____ Recorded Plat _____			
5. Private Claims _____			

Register of Deeds Stamp & File Number

I, Robert L. Wetherell, in a field survey on January 25, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**K-8 - 1/4 Corner common to Sections 23 & 24, T18N, R14W**

**A. Description of original monument and accessories and/or subsequent restoration:**

1838 - S. Sibley, G.L.O.

#1 - 8" W. Oak N54°E 9 Links  
#2 - 8" W. Oak S25°W 16 Links

Undated - G.H. Johnson, Co. Sur. (1915-1930)

Iron & 4 Bricks  
#3 - B. Oak S26°W 58.3'  
#4 - 10" Y. Pine S26 1/2°E 26.3'

1964 - R.A. Griffin, LS 13584

L.C.R.C. - L. 01, Pg. 135  
Found 5/8" Bolt and 4 Bricks  
Set 5" Concrete Monument  
#5 - 10" W. Oak N47°E 86.70'  
#4 - 18" R. Pine S26°E 27.15'  
#3 - 19" B. Oak S26°W 58.35'  
#6 - 22" W. Pine N34°W 93.75'

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

I found Griffin's 5" Concrete Monument in North and South road.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Found in good condition, #4 Found in good condition, #5 Found in good condition, #6 Found in good condition.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

I accepted the 5" Square Concrete Monument as a substantial marker for the corner, and is accepted as a careful and faithful re-establishment of the position of the original corner.

12" W. Oak N51°E 86.48' (60d spike in S.E. side) #5  
21" R. Pine S22°E 27.18' (60d spike in N.E. side) #4  
24" B. Oak S29°W 58.23' (60d spike in N.E. side) #3  
28" W. Pine N30°W 93.77' (60d spike in S.W. side) #6

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP  
IN ACCORDANCE WITH P.A. 345  
CHAIRMAN *R.W.*  
DATE 7-20-99

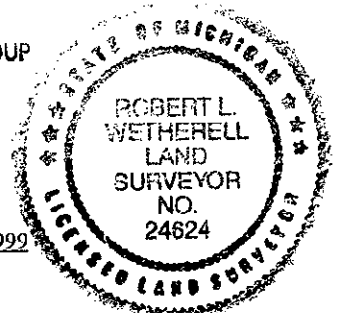

Signed by Robert L. Wetherell

Date July 21, 1999

Surveyor's Michigan License No. 24624