

REMONUMENTATION

NOV 21 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED
LAKE COUNTY, MI.
LIBER 004 PAGE 0045

SEP 12 10 32 AM '97

For corners in

Table with columns: Lake (County), Located In: (19N, 11W), Corner Code ## (c-10). Rows include Public Land Survey, Property Controlling in Section, and Miscellaneous Property in Sec.

REGISTER OF DEEDS

Register of Deeds Stamp & File Number

- 4. Lot No. Recorded Plat
5. Private Claims

Grid table with columns A-M and rows 2-13. A dot is marked at the intersection of column C and row 10.

I, Robert L. Wetherell, in a field survey on February 24, 1997, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- c-10 - 1/4 Corner common to Sections 29 & 30, T19N, R11W, Lake Co., Mi.
1838 - S. Sibley, G.L.O.
1907 - J.W. Nichoson, Co. Sur.
1996 - Robert L. Wetherell, LS 24624
#1 - 16" Hemlock N53°W 5 Links
Set by single proportionate method
L.C.R.C. - Liber 03, Pg. 343
#2 10" Pine S58° 9 Links
#3 - 24" W. Pine Stump S38°E 41 Links
Set 1/2" Re-bar at recorded bearing and distance from recovered Nichoson's accessory No. 3.
#4 - 10" Maple N75°E 72.08'
#5 - 4" W. Pine S3°W 25.47'
#6 - 11" B. Oak S66°W 64.20'
#7 - "Found" 5/8" Rod N35°W 14.08'


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

c-10 - 1/4 Corner common to Sections 29 & 30, T19N, R11W, Lake Co., Mi.
I found the 1/2" Capped Iron I set in 1996, in the intersection of fences North, South and East.
Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Found in poor condition, #4 Found in good condition, #5 Found in good condition, #6 Found in good condition, #7 I removed the 5/8" Rod.

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP
IN ACCORDANCE WITH P.A. 345
CHAIRMAN R.L.W.
DATE 8-27-97

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

c-10 - 1/4 Corner common to Sections 29 & 30, T19N, R11W, Lake Co., Mi.
I replaced the 1/2" Capped Iron with a 3/4" x 24" Re-bar with Lake County Brass Cap, and is accepted as a careful and faithful re-establishment of the position of the original corner.
10" Maple N75°E 72.08' #4
4" W. Pine S3°W 25.47' #5
11" B. Oak S66°W 64.20' #6
4" W. Oak S35°E 52.11'

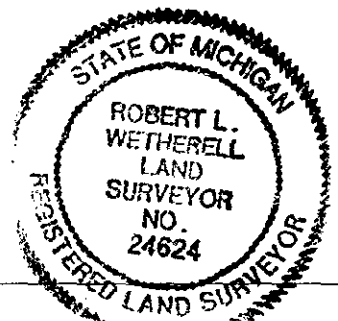

Signed by Robert L. Wetherell
24624

Date 8-27-97

Surveyor's Michigan License No.