

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 19 N. R. 12 P	H-9; I-9; I-10; I-11
2. PROPERTY CONTROLLING IN SECTION 27	T. 19 N. R. 12 W	15
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. R. E. S. R. W.	
4. LOT NO. , RECORDED PLAT		
5. PRIVATE CLAIMS		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, **Carl F. Roser** do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on **November 12, 1974**, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on **19**, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and/or subsequent re-establishment~~

C. (continued)

	I-11		15
Found USBT stumps, added DNR mon. & ced. post		Set 1"x6' pipe & ced. post w/loc. tag	
7" R. Pine N40°E 70.3		8" Cedar S53°E 8.8	
5" R. Oak S25°E 5.1		8" Cedar S17°W 6.0	
10" R. Oak S80°W 20.1		4' Stream Due W 100	
Crooked N-S fence Due W 28		E-W fence Due S 48	

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- H-9 Recovered Robert Griffin, RLS, corner.
- I-9 Found and accepted 1/2"x1/2"x12" iron rod by RLS R. Griffin.
- I-10 Restored corner per standard B.L.M. instruction (single proportion). Fence corner 12' - E and 100' - N. Old fence corner, N25°E 25', with crooked fence N'ly, E'ly & S'ly
- I-11 Recovered original corner, from USBT stumps, one showing excellent lower face. Fairly old corner fence post (fence N'ly and W'ly) is 134' - S and 18' - W.
- 15 Established corner per standard B.L.M. instruction. Also see item "B" for corner G-11.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-9	I-9	I-10
Found 1/2"x1/2" iron & added DNR mon. Power Pole N05°E 60.44	Found iron, added DNR mon. buried Telephone Pole N61°E 33.79	Set DNR mon. & ced. post 7" S. Maple N60°W 14.8
RR spike in power pole S37°W 67.95	12" Maple N24°W 51.90	5" S. Maple N25°E 25.1
NE corner conc. cabin N46°W 129.73	set ced. post w/loc. tag Due S 33	12" Beech S40°E 41.8
set ced. post w/loc. tag Due W 33		


SIGNED BY: Carl F. Roser 1-16-75 DATE

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY: _____ DATE: _____

APPROVED AND SIGNED BY: _____ DATE: _____

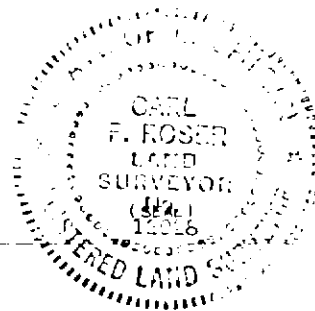

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ SOUTH NEWKIRK TOWNSHIP
LAKE COUNTY