

**SURVEY &
REMONUMENTATION**

JAN 25 2001 LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

SECTION

For corners in
Lake _____

Located in: Corner Code#

1. Public Land Survey	T 19 N	R 12 W	I-2
	T _____	R _____	_____
	T _____	R _____	_____
	T _____	R _____	_____
2. Property Controlling in Section	S _____	T _____	R _____
	S _____	T _____	R _____
3. Miscellaneous Property in Sec.	S _____	T _____	R _____
	S _____	T _____	R _____
4. Lot No. _____ Recorded Plat _____			
5. Private Claims _____			

RECORDED
LAKE COUNTY, MI.
LIBER 004 PAGE 0252
MAY 5 10 27 AM '00

Robert L. Wetherell
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on February 23, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

I-2 - 1/4 Corner common to Sections 2 & 3, T19N, R12W

A. Description of original monument and accessories and/or subsequent restoration:

1838 - S. Sibley, G.L.O.

- #1 - 30" W. Pine N85°W 31 Links
- #2 - 20" W. Pine S45°E 28 Links

1907 - J.W. Nicholson, Co. Sur.

- "Corner fully identified, old post dug up".
- #3 - 12" B. Oak S55-1/2°W 18 1/2 Links
- #4 - 24" Pine Stump S75°E 49 Links
- #5 - Measured 2640' South
- #6 - Measured 2885.5' North

1980 C. Roser, LS 12028

- L.C.R.C. - Liber 02, Pg. 384
- Set 5/8" rod in centerline of road in line with old fence to east.
- #7 - 6" W. Oak N45°W 43.7'
- #8 - 9" W. Oak N40°E 55.3'
- #9 - Post - West 33'
- #5 - Measured 2643 South
- #6 - Measured 2902 North

1999 - R.L. Wetherell, LS 24624

- Survey recorded Liber 04, Pg. 360.
- Set 1/16 corner South of this corner
- At a distance of 1321.40'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found Roser's 5/8" rod in centerline of road north and south and in line with old fence to East.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Gone, #5 2642.80', #6 2902.7', #7 Found stump, #8 Found in good condition, #9 Found in good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced the 5/8" rod with a 3/4" x 24" rebar with Lake County Remon Cap, and is accepted as a careful and faithful reestablishment of the position of the original corner.

- 7" W. Pine S17°E 74.02' (60d spike in W. side)
- 6" W. Pine S80°E 35.50' (60d spike in S. side)
- 12" W. Oak N35°E 58.27' (60d spike in S.E. side)
- 13" W. Pine S79°W 148.92' (60d spike in S. side)

PATIFIED BY THE LAND CORNER REVIEW GROUP
IN ACCORDANCE WITH P.A. 345
SURVEYOR R.L.W.
DATE 4-11-2000

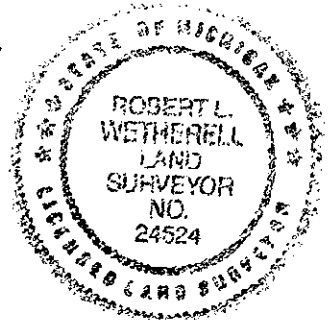

Signed by Robert L. Wetherell
Surveyor's Michigan License No. 24624

Date April 12, 2000