

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. PA 1970

For Corners In:
Lake _____ Located In _____ Corner Code # _____
(County) _____


1. Public Land Survey T 19N R 12W D3
T _____ R _____ _____

2. Property Controlling in Section S T R _____
S _____ T _____ R _____

3. Miscellaneous Property in Section S T R _____
S _____ T _____ R _____

4. Lot No: _____ Recorded Plat: _____

5. Private Claims: _____

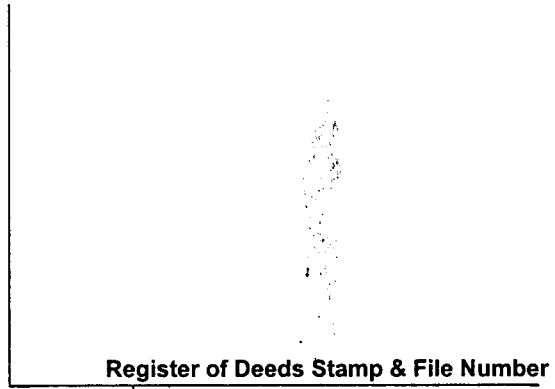

I, Craig W. McVean, in a field survey on May 23, 2001 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3				●									
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

D3 - GLO - 1/4 Sec. Corner in stream - S. Sibley - 1838
Pine 30" N56°W 54 L. This fits C. Cole's subdivision of Sec. 8.
- G.H. Johnson - B. Oak 8" S20°E 113 L. Ctr. of E-W Bit. Rd. S 4.6'
B. Oak 11" S29°W 49 1/2 L. Set Cedar post w/ loc. tag N 33'
- LCRC - L. 2, P. 385 - C.F. Roser - 1980 8" B. Oak N35°W 41.0'; 9" B. Oak N50°E 46.3'
Drove 3/4" x 22" pipe, equal distance & on line between the SE & SW corners of Sec. 5.

B. Description of corner evidence found and/or method applies in restoring or re-establishing corner:

D3 - 1/4 Cor. common to Sec. 5 & 8 - Fd. 3/4" iron pipe in Bit. Rd. per Roser's LCRC. Fd. stps. of both of Roser's BT's. No evidence of Johnson's BT's. GLO position is suspect since there is no stream within any reasonable distance of this corner position. 3/4" iron pipe is accepted as a careful & faithful re-establishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D3 - 3/4" iron pipe - 4.6' N of CL of E-W Bit. Rd.
N 32.65' to face Fd. cedar post w/ loc. tag (CFR)
N38°E 62.29' to set N & T in SE side 3" W. Oak
S36°E 139.91' to set N & T in W side 3" W. Pine
S1°E 102.86' to set N & T in W side 6" W. Oak Scribed 'XBT'
S45°W 174.47' to set N & T in E side 5" R. Pine Scribed 'XBT'



Signed by: Craig W. McVean
Surveyor's Michigan License No.: 39088

Date: 11/26/2001