

JAN 25 2001

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

SECTION

For corners in Lake _____

Located in: Corner Code#

- 1. Public Land Survey T 19 N R 13 W B-9
 T R
 T R
 T R
- 2. Property Controlling in Section S T R
 S T R
- 3. Miscellaneous Property in Sec. S T R
 S T R
- 4. Lot No. _____ Recorded Plat _____
- 5. Private Claims _____

RECORDED
 LAKE COUNTY, MI.
 LIBER 004 PAGE 0275
 DEC 8 11 21 AM '00
Shirley Myers
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Robert L. Wetherell, in a field survey on February 23, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9	30	29	28	27	26	25							
10													
11	31	32	33	34	35	36							
12													
13													

B-9 - 1/4 Corner common to Sections 19 & 30, T19N, R13W

A. Description of original monument and accessories and/or subsequent restoration:

1838 - S. Sibley, G.L.O.

- #1 - 18" Pine N8°E 30 Links
- #2 - 9" B. Oak S73°W 26 Links

1989 - S. Barnett, LS 16923

- L.C.R.C. - Liber 03, Pg. 85
- Survey recorded Liber 03, Pg. 183.
- Set 5" Square Concrete Monument by single proportionate method.
- #3 - 6" Oak N55°E 38.70'
- #4 - 7" Oak S37°E 31.50'
- #5 - 5" Oak S54°W 37.50'
- #6 - Carsonite Post - West 20'

B. Description of corner evidence found and/or method applied in restoring of reestablishing corner:

I found a 5" Square Concrete Monument in East rack of a North and South two-track road.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Found in good condition, #4 Found in good condition, #5 Found in good condition, #6 Found in good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I accepted the 5" Square Concrete Monument as a substantial marker for the corner, and is accepted as a careful and faithful reestablishment of the position of the original corner.

- 8" B. Oak N57°E 38.70' (60d spike in S.E. side) #3
- 10" B. Oak S36°E 31.47' 960d spike in W. side) #4
- 8" W. Oak S60°W 37.53' (60d spike in N.W. side) #5
- 7" W. Oak N55°W 51.97' (60d spike in N. side)
- 8" W. Oak S65°E 65.84' (60d spike in S. Side)

ATTESTED BY THE LAKE CO. PEER REVIEW GROUP
 IN ACCORDANCE WITH P.A. 345
 CHIEFMAN R&W
 DATE 12-5-2000

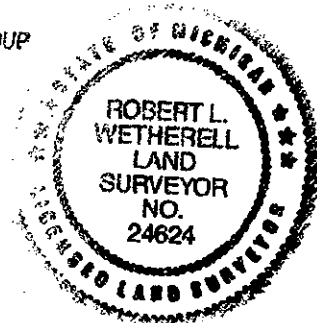

Signed by

Robert L. Wetherell

Date December 6, 2000

Surveyor's Michigan License No. 24624