

**SURVEY & REMONUMENTATION**

**AUG 31 1999**

**LAND CORNER RECORDATION CERTIFICATE**

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

**SECTION**

RECORDED  
LAKE COUNTY, MI.  
LIBER 004 PAGE 0205  
JUL 23 3 05 PM '99

For corners in Lake _____	Located in:	Corner Code#	
1. Public Land Survey	T 20N	R 11W	J-11
	T _____	R _____	_____
	T _____	R _____	_____
	T _____	R _____	_____
2. Property Controlling S in Section	T _____	R _____	_____
	S T _____	R _____	_____
3. Miscellaneous Property in Sec.	S T _____	R _____	_____
	S T _____	R _____	_____
4. Lot No. _____ Recorded Plat _____			
5. Private Claims _____			

*Richard N. Richard*  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, **Robert L. Wetherell**, in a field survey on June 2, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**J-11 - 1/4 Corner common to Sections 26 & 35, T20N, R11W**

**A. Description of original monument and accessories and/or subsequent restoration:**

**1838 - S. Sibley, G.L.O.**

#1 - 12" Beech S6°W 31 Links  
#2 - 8" Beech N2°E 15 Links

**1990 - D. Wood, LS 24625**

L.C.R.C. - L. 03, Pg. 104  
Found 1" Pipe  
#3 - 36" Oak AZ 40° 32.6'  
#4 - 36" Oak AZ 130° 57.0'  
#5 - Fence Post AZ 180° 35.6'

**1998 - C. Pullen, LS 39095**

Survey recorded in L. 04, Pg. 276  
Found 1" Iron  
#6 - Fence Post S40°W 32.66'  
#7 - Fence Post North 29.21'  
#3 - 30" Maple N40°E 32.50'  
#4 - 30" Maple S40°E 56.80'

**B. Description of corner evidence found and/or method applied in restoring of reestablishing corner:**

I found an old 1" x 18" threaded rod in centerline of East-West road and in line with fences North and South.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Found in good condition (Maple Tree), #4 Found in good condition (Maple Tree), #5 Gone, #6 Found in good condition, #7 Found in good condition.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

I replaced the threaded rod with a 3/4" x 24" re-bar with Lake County Remon Cap, and is accepted as a careful and faithful re-establishment of the position of the original corner.

13" R. Pine S27°W 63.92' (60d spike in S.E. side)  
11" S. Pine S11°E 71.15' (60d spike in E. side)  
30" Maple N40°E 32.39' (60d spike in S.E. side) #3  
30" Maple S40°E 56.90' (60d spike in N.E. side) #4  
Fence post N4°E 29.06' (60d spike in E. side) #7

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP  
IN ACCORDANCE WITH P.A. 345  
CHAIRMAN *RJW*  
DATE 7-20-99

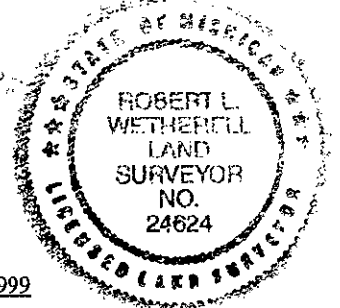

Signed by *Robert L. Wetherell*

Date July 21, 1999

Surveyor's Michigan License No. 24624