

SURVEY &
REMONUMENTATION

MAR 13 1998

SECTION

REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECEIVED FOR RECORD

98 FEB 26 PM 3:05

For corners in _____
Lapeer _____

Located In: _____ Corner Code: A-3

1 Public Land Survey	T <u>7N</u> R <u>11E</u>	<u>A-3</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2 Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3 Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

4 Lot No. _____ Recorded Plat _____

5 Private Claims _____

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

MICHAEL G. HAY in a field survey on AUGUST, 19 97
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law: established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
- 1824 GLO; L. Lyon D.S.; Set post; Beech 19 N 60E 43'
 - 1874 Gilbert Bates C.S. Stone 18-17-9 on top of Halls Apple 2 S 42½ E 63' B. oak 36 S 66 W 48'
 - 1978 Bernard Henderson P.S. 16043 L004 P780 survey set ½" iron S 80 W 101.80' Power Pole S 20 E 59.95' 24" Maple S 10 E 103.00' 26" Maple
 - 1982 Bernard Henderson P.S. 16043 L006 P434 surveys fnd ½" iron
 - 1985 Harold N. Elrich P.S. 18986 L007 P106 surveys fnd ½" iron (same wits as 1978 survey above)
 - 1988 Earl E. Gravlin P.S. 23510 L007 P974 surveys fnd ½" iron (same wits as 1978 survey above)
 - 1988 Earl E. Gravlin P.S. 23510 L008 P133 surveys fnd ½" iron (same wits as 1978 survey above)
 - 1989 Harold N. Elrich P.S. 18986 Not Recorded fnd ½" iron (same wits as 1978 survey above)

(CONTINUED).....


- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- 1997 ROWE ENG; Michael G. Hay P.S. 41101 fnd ½" iron in centerline of Five Lakes Road and centerline of M-21 from the East: Recovered 3 previous witnesses indicating that fnd ½" iron is in the same position as 1978; iron cited above.

- A-3 to A-2 2652.60'
- A-3 to A-4 2633.73'
- A-3 to B-3 2451.09'
- A-3 to M-3 (Lapeer) 117.54' GLO (1.73) 114.18' NORTH

Michael G. Hay
10-12-97

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-3 Placed Remonumentation cap on fnd 1/2" iron
North 117.54' remon cap on ½" iron
S 20 E 59.95' spike 24" maple
S 10 E 103.00' spike 26" maple
S 80 W 101.80' spike power pole

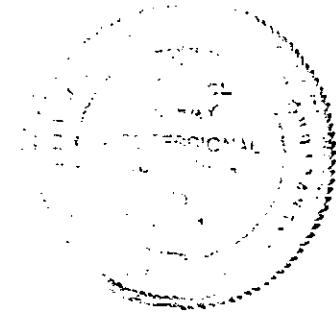

Signed by Michael G. Hay Date September 26, 1997

Surveyor's Michigan License No. 41101

(continued)

A.

- 1996 Harold N. Elrich p.s. 18989 Not recorded fnd 1/2 " iron
S 80 w 101.80" Power Pole S20 E 59.95' 24" Maple North
117.66' remon. in Mon Box
- 1996 Harold N. Elrich P.S. 18986 L 011 P 826 survey fnd 1/2"
iron (same wits as 1996 surveysabove)