

**SURVEY & REMONUMENTATION**

**MAR 13 1998**

**SECTION**

**REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970**

RECEIVED FOR RECORD

98 FEB 26 PM 3:11

For corners in

LAPEER

(County)

Located In:

Corner Code #

- 1. Public Land Survey      T 8N R 10E      A-5  
                                   T \_\_\_\_\_ R \_\_\_\_\_  
                                   T \_\_\_\_\_ R \_\_\_\_\_  
                                   T \_\_\_\_\_ R \_\_\_\_\_
- 2. Property Controlling    S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
    in Section               S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
- 3. Miscellaneous           S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
    Property in Sec.         S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

*Michael G. Hay*  
REGISTERED PROFESSIONAL SURVEYOR  
LAPEER MICHIGAN

Register of Deeds Stamp & File Number

I, MICHAEL G. HAY, in a field survey on AUGUST, 19 97, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

- 1824 S. Sibley set stake set post pine 22 S 18 E 23 west oak 25 N 20 E 53
- 1973 Bernard Henderson P.S. 16043 L002 P239 surveys set 1/2" iron rod  
     N 35 E 53.15' 36" oak N 40 W 40.21 28" oak S 37 W 33.58' 36" oak  
     S 30 E 58.20' 40" oak
- 1994 Harold N. Elrich P.S. 18986 L 010 P 694 surveys fnd 1/2" iron in mon box  
     S 30 E 58.93' PK nail washer 30" oak N 45 W 35.29 PK nail washer 20" oak  
     S 45 W 32.02' PK nail washer 28" oak south 92.46

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


1997 ROWE ENG; Michael G. Hay P.S. 41101 fnd 1/2" iron at centerline of Millville Road north-south and fence and tree line to the east. Recovered 3 previous witnesses indicating that fnd 1/2" iron is in the same position as 1994 iron sited above.

- A-5 to A-4 2658.70'
- A-5 to A-6 2651.31'
- A-5 to B-5 1983.86'
- A-5 to M-5 (Oregon) 92.46' SOUTH GLO (1.70) 112.20'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- A-5 set standard remon cap on fnd 1/2" iron in mon box
- N 45 W 35.29 PK washer in 20"; oak
- N 35 E 53.60' spike 26" oak
- S 30 E 58.93' PK washer 30" oak
- S 45 W 32.03' PK washer 28" oak

*Michael G. Hay*  
10-13-97

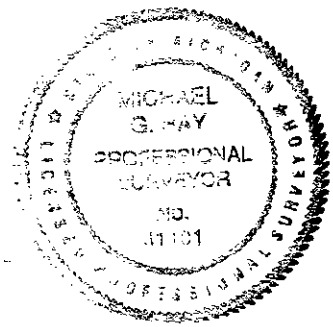

Signed by Michael G. Hay Date September 26, 1997

Surveyor's Michigan License No. 41101