

Filed under Remonumentation Act 345 of 1990
LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

JAN 23 2000

LIBER 1 PAGE 342

STATE OF MICHIGAN
 LENAWEЕ COUNTY
 FILED

29 SEP 1999 5:56:43 PM

VICTORIA J. DANIELS
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

SECTION

For corners in

Lenawee Located In: Corner Code #
 (County)

1. Public Land Survey	T	5	S	R	2	-	E	A-11
	T			R				
	T			R				
	T			R				
2. Property Controlling in Section	S			T				
	S			T				
3. Miscellaneous Property in Sec	S			T				
	S			T				

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, Glenn E. Richard, in a field survey on July 19, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2								
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. 1824, Hervey Parke Intersect W. boundary 62L (40.92') S. of post. Set post at intersection corner Sec.'s 30 & 31 W. Oak 10 N 15 E 39 W. Oak 8 S 19 1/2 W 22 1/2
 Could not find any information on this corner in any of the old survey records.
 1935 Walter Frazier surveyed Slee Rd. didn't put anything in his notes about this corner
 1972 Werner Sommer re-established the corner (iron pipe in the pavement) 40.92 feet South from the N.E. corner of Sec. 36 T5S R1E and on line to the E. 1/4 corner of Sec. 36 T5S R1E and recorded it in Liber 1, Page 673
 1995 Steve Young found iron pipe
 1999 Mike Bartolo found capped iron in monument box

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


July 19, 1999 Found 3/4" X 14" iron pipe in the pavement 3" under new asphalt pavement.
 Replaced the iron pipe with 5/8" X 3' re-rod with Lenawee County Re-mon cap stamped P.S. 13040.
 Set mon box with top 1 3/4" high to be level with final course of pavement

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3' re-rod with Lenawee County re-mon cap stamped P.S. 13040 in monument box and is accepted as the best available evidence of the position of the original corner.

 Fd. dbl hd nail and disc in E.P. S 5° W 54.21
 Fd. nail & M. Bartolo brass tag in wood corner post N 50° E 47.02
 Set dbl hd nail & re-mon tag at overgrown nail in 16" Oak N 10° W 109.84
 Set survey mark spike & re-mon tag in 8" Hickory N 30° W 66.66
 The corner is 8 1/2' ± North of East-West pavement centerline and 3'± West of North-South pavement centerline

 M-11 T5S R1E North 40.88

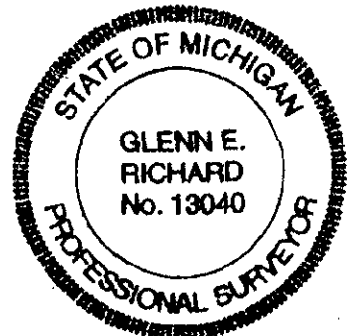

Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date September 14, 1999

Signed by Glenn E. Richard Date Sept. 24, 1999
 Glenn E. Richard

Surveyor's Michigan License No. 13040