

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Luce

(County)

Located In:

Corner Code ##

- | | | |
|------------------------------------|--------------------------|------------|
| 1. Public Land Survey | T <u>45N</u> R <u>8W</u> | <u>D13</u> |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Jul 29 1999

I, Stephan J. Szyszkoski, in a field survey on _____, 19 _____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:


(D13) South 1/4 corner of Section 32. Corner remonumented in 1956 by Billy D. Buckler RLS from original Tamarack BT (GLO record shows Tamarack 5 N10E 57 links). Buckler placed 1" pipe with 4" brass cap at corner. 9" White Pine N30E 107 links for witness. This corner was incorrectly recorded by Buckler as also being the North 1/4 corner for Section 5, T44N-R08W. There being closing corners on the line between T44N and T45N in this range, the monument is a standard corner controlling only the direction of the north line of T44N-R08W.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(D13) Recovered the 1956 monument as described, a 1" ID iron pipe capped with a 4" brass MI Dept. of Conservation tablet, in good condition, and at record bearing and distance from Buckler's W.Pine witness. Left the monument in place and made 4 new accessories as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(D13) Found 1" pipe with 4" brass cap.
 Blazed, scribed, and set measuring nails
 in the following:
 5" Tamarack N60E 3.1' "1/4S NBT"
 4" W.Pine South 7.9' do
 4" Tamarack S69W 18.9' do
 4" Spruce N35W 11.6' do
 Placed 4" squared and scribed post
 adjacent. Bearings are magnetic.
 Distances are to nail with tag.

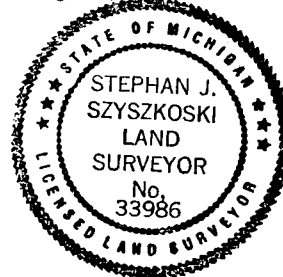

Signed by Stephan J. Szyszkoski Date 4/18/00
 Surveyor's Michigan License No. 33986