

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Luce	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>45N</u> R <u>8W</u>	<u>K12</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

May 10 2005

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													


A. Description of original monument and accessories and/or subsequent restoration:
 (K12) Quarter corner common to Sections 35-36. 1849: Established by Wm. Ives, Deputy Surveyor: "North between Sections 35 & 36 ... 40.00 Set qr Section post. Sugar 6 N85W 10, Sugar 7 S60E 22 ... 80.00 Section corner". 1972: Reestablished by Billy D. Buckler RLS midway and on line between Section corners. Set 1" pipe with 4" alum. cap. 14" Soft Maple N73E 31.4', 8" Soft Maple N16W 45.2'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(K12) Found the 1972 monument in good condition and at record bearing and distance from the 1972 witnesses, both in good condition with overgrown blazes. Found the monument to be 0.04' West and 0.99' South of the midway position described in the 1972 record and accepted same as a careful and faithful reestablishment of the position of the original corner. Made new blazes on the 1972 N8Ts.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K12) Found 1" ID I. pipe with 4" alum. MDNR cap. Set measuring nails in:
 20" Maple N79E 32.05' mrdk "1/4S" *
 10" Maple N11W 45.65' do *
 4" Elm S67W 26.75' mrdk "1/4S NBT"
 5" Elm S36W 20.9' do
 Bearings are magnetic. Distances are to nail with tag. * denotes 1972 NBT.

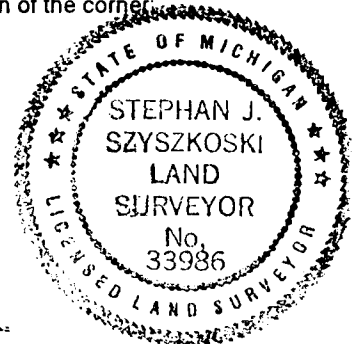

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 6/21/05