

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Luce Co.

3 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>45</u> N. S. R. <u>9</u> W.	C-7, C-8, B-7
2. PROPERTY CONTROLLING IN SECTION	T. _____ N. S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey 5/10, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners set by Wm Ives, D.S. in 1849.

C-7 Sec. Cor. 17-18-19-20. Bearings were: Beech 10", S33°W, 19 lks. & Sugar 12", N53°E, 28 lks.

C-8 Quarter Cor. bet. Sec's. 19-20. Bearings were: Hemlock 12", N15°E, 29 lks. and Sugar 7", S24°W, 30 lks.

B-7 Quarter Cor. bet. Sec's. 18-19. Bearings were: Fir 10", S55°W, 17 lks. and Y. Birch 20", N42°E, 16 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

C-7 Monumented corner at an old wood post on west edge of woods road. Appears to line up with road to South. Distance North, West and South to other corners good.

C-8 Corner re-established midway bet. two Sec's. Cors. No other evidence.

B-7 Corner re-established midway bet. two Sec. Cors.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" Dep't. cap at all corners.

C-7 New Bearings: 9" Soft Maple, N83°W, 57.9' and 5" Hard Maple, S17°W, 56.0'


C-8 New Bearings: 11" Soft Maple, S45°E, 8.4' and 8" Soft Maple, S73°W, 34.5'

B-7 New Bearings: 7" R. Pine, East, 20.3' and 8" R. Pine, S37°W, 18.8'

Squared and scribed a 6" R. Pine, 1.0' West of corner. Corner lies on North edge of R. Pine Plantation.

SIGNED BY Billy D. Buckler
Billy D. Buckler
SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

DATE 1/17/77

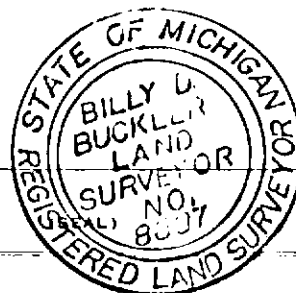

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____