

# LAND CORNER RECORDATION CERTIFICATE

**FILING REQUIREMENT OF ACT 74, MICH. P.A.1970**  
Luce Co. Three Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>45</u> <sup>N.</sup> <del>S.</del> , R. <u>9</u> <sup>E.</sup> <del>W.</del>	G-7 G-9 & D-9
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 9-20 & 10-8 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

- Corners set by William Ives, D.S. in 1849.
- G-7 Sec. Cor. 15-16-21-22. Bearings were: Cedar 10", N15°W, 24 lks & Spruce 8", S50°E, 13 lks.
  - G-9 Sec. Cor. 21-22-27-28. Bearings were: Y. Birch 12", S36°E, 39 lks & Cedar 8", N20°W, 33 lk.
  - D-9  $\frac{1}{4}$  Cor. bet. Secs. 20-29. " " Fir 12", N73°E, 23 lks & Sugar 6", N45°W, 21 lks.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

- G-7 Corner re-established from cors.;  $\frac{1}{2}$  mile South, Fence Cor.,  $\frac{1}{2}$  mile West; Corners, 1 mile North and stream calls to East. Found numerous cedar stump remains but could not identify any as original witnesses. Found old blazes to South, which confirms this position.
- G-9 Corner re-established from a corner  $\frac{1}{2}$  mile North; streams to South and East and a corner 1 mile West. Found old blazes to North but no original evidence.
- D-9 Corner re-established midway and on line bet. two Sec. Cors. Location is in West Half of a N-S road.


**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- Placed 1" pipe with 4" aluminum cap at G-7 & G-9 corners.
- G-7 New Bearings: 7" Cedar, N80°W, 19.4' & 7" Cedar, South, 19.2'
  - G-9 New Bearings: 15" Spruce, S76°E, 40.7' & 8" Balsam, S59°W, 11.5'  
Corner lies 15' North of an old winter road.
  - D-9 Buried 1" x 30" iron pipe in road.  
New Bearings: 6" R. Pine, N30°W, 55.6' & 4" R. Pine, S75°W, 36.8'

SIGNED BY Billy D. Buckler  
Billy D. Buckler

DATE 10-30-74

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

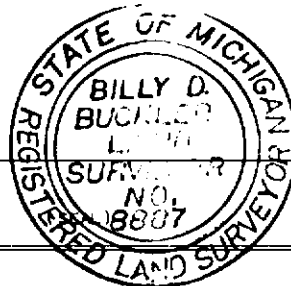

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_