

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Luce Co.

4 Corners

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>46</u> N. <u>X</u> , R. <u>9</u> E. <u>X</u>	H-7, H-9, I-9, I-8
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ S., R. _____ E. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ S., R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 2-15, 7-29, 6-19, 19 80, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners were placed by Harvey Mullan, D.S. in 1850. Bearings were:

- H-7 $\frac{1}{4}$ Cor. bet. Sec's. 15-22. Tamarack 7", S31°W, 12 lks. & Tamarack 8", N54°E, 12 lks.
- H-9 $\frac{1}{4}$ Cor. bet. Sec's. 22-27. Hemlock 20", S60°W, 58 lks. & Hemlock 7", N36°E, 35 lks.
- I-9 Sec. Cor. 22-23-26-27. Hemlock 8", N60°W, 21 lks. & Hemlock 6", S33°E, 10 lks.
- I-8 $\frac{1}{4}$ Cor. bet. Sec's. 22-23. Cedar 8", N26°W, 8 lks. & Cedar 7", S19°E, 18 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- H-7 Replaced corner from original Tamarack, N54°E, 12 lks. B.T. in good condition. Corner lies on NW side of a low ridge.
- H-9 Placed corner at wood post located proper bearing and distance from a hemlock stump, which could be the SW witness. Corner lies on a straight line and midway bet. two Sec. Cors.
- I-9 Restored corner at site of an old wood post, set by unknown persons. Position checks with Quarter Cors to West and North. Several Hemlocks stumps in vicinity, none identified as with
- I-8 Restored corner at an old blazed Cedar. Distance North to river checks. Found several old blazes in vicinity and to North and South.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at all corners. New Bearings are:

- H-7 8" Cedar, S50°W, 44.2' & 6" Cedar, S6°W, 8.0' & 6" Cedar, S74°E, 29.3'.
- H-9 11" Soft Maple, N28°E, 42.0' & 6" Soft Maple, S52°W, 66.5' & 6" Cedar, N65°W, 54.5'.
- I-9 20" Soft Maple, (XXX NBT), N37°W, 93.7'. Corner lies 3.0' North and 3.0' West of a squared Balsam tree. All other trees are Aspen, Balsam, and Spruce. Cor. lies West edge of low ridge.
- I-8 10" Cedar, S37°W, 24.4' & 10" Cedar, S35°E, 29.4' & 10" Cedar, N79°E, 10.6'.

SIGNED BY Billy D. Buckler DATE 7-30-80
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

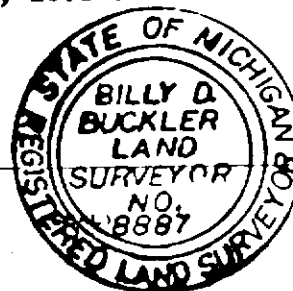

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____