

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Luce Co.

3 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>46</u> N. <u>X</u> , R. <u>9</u> <u>X</u> W.	G-8, H-8
2. PROPERTY CONTROLLING IN SECTION <u>22</u>	T. <u>46</u> N. <u>X</u> , R. <u>9</u> <u>X</u> W.	3-Sec.22
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____, R. _____ E. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 2-27, 6-19, 2-17, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- G-8 Quarter Corner bet. Sec's. 21-22, set by Harvey Mullen, D.S. in 1850. Bearings were: Hemlock 16", N56°E, 12 lks. & Hemlock 16", S70°W, 26 lks.
- H-8 Center Corner, Section 22.
- 3-Sec.22 North 1/16 Corner on West side of Section 22.


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- G-8 Replaced corner at site of an old wood post, which agrees with corners to North and South. Found no positive evidence of original witnesses. Found 1 1/4" iron pipe, 50' West of corner. Corner lies midway and on line bet. two Section corners.
- H-8 Placed corner at intersection of lines connecting opposite Quarter Corners.
- 3-Sec.22 Placed corner midway and on line bet. Sec. Cor. to North and 1/4 Cor. to South. Corner lies 1.0' East and 1.0' South of a Wood Post.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Placed 1" pipe with 4" aluminium cap at all corners. New Bearings:
- G-8 8" Cedar, (1/4 S NBT), N15°W, 47.6' & 13" Soft Maple, (1/4 S NBT), S84°W, 57.8' & 6" Cedar, (1/4 S NBT), N75°E, 23.1'.
 - H-8 8" Cedar, (C 1/4 NBT), S40°E, 55.6' & 13" Cedar, (C 1/4 NBT), N73°E, 53.1' & 12" W. Birch, (C 1/4 NBT), N66°W, 38.9'.
 - 3-Sec.22 15" Hemlock, (N1/16 BT), N58°E, 65.8' & 16" Hemlock, (N1/16 BT), S10°E, 7.2' & 7" R. Maple, S65°W, 4.1'.

SIGNED BY Billy D. Buckler DATE 7-30-80
 Billy D. Buckler 8387
 SURVEYOR'S MICHIGAN REGISTRATION NO. _____

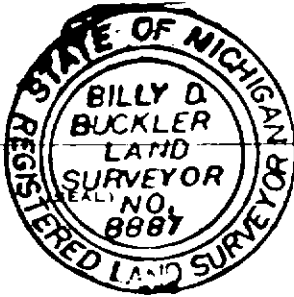

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____