

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970
Luce Co. Two Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>46</u> ^{N.} S. R. <u>9</u> ^{X.} W.	G-7 - E-8
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ ^{N.} S. R. _____ ^{E.} W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ ^{N.} S. R. _____ ^{E.} W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 2-15 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- G-7 Sec. Cor. 15-16-21-22, set by Harvey Mellen, D.S. in 1850.
Bearings were: Tamarack 9", S85°W, 35 lks. and Tamarack 8", N44°E, 22 lks.
- E-8 Quarter Corner bet. Sec's. 20-21, set by Harvey Mellen, D.S. in 1850.
Bearings were: Cedar 8", S39°W, 32 lks. and Hemlock 8", N20°E, 48 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- G-7 Corner replaced from one tamarack B.T. Found woodpost, set by unknown, in proper position.
- E-8 Re-established corner. Found a squared Hemlock tree 20' West of corner. Distance South to swamp edge and to Sec. Cor. checks well. Found no positive evidence of original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Placed 1" pipe with Dep't cap at both corners.

- G-7 New Bearings: 10" Cedar, S67°E, 19.4' and 8" Cedar, S79°W, 9.5'
- E-8 New Bearings: 8" Cedar, S86°W, 34.5' and 12" Cedar, S18°E, 35.7'

SIGNED BY Billy D. Buckler DATE 12-16-74

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

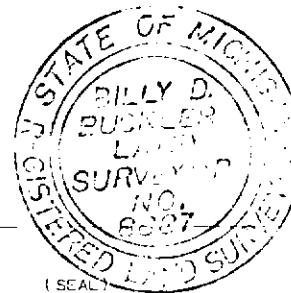

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ CHIEF OF SURVEY PARTY DATE _____
APPROVED AND SIGNED BY _____ MICHIGAN REGISTERED LAND SURVEYOR DATE _____
(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____