

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970
Luce Co. Four Corners.


FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>46</u> N. <input checked="" type="checkbox"/> , R. <u>10</u> W. <input checked="" type="checkbox"/>	C-3 C-2 E-2
2. PROPERTY CONTROLLING IN SECTION <u>5</u>	T. <u>46</u> N. <input checked="" type="checkbox"/> , R. <u>10</u> W. <input checked="" type="checkbox"/>	10-Sec.5
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____, R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 1-31 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- C-3 Sec. Cor. 5-6-7-8, set by Geo. H. Cannon D.S. in 1853.
Bearings were: Maple 7", S68°E, 29 lks. and Y. Birch 10", S19°W, 18 lks.
 - C-2 Quarter Corner bet. Secs. 5-6 set by Geo H. Cannon D.S. in 1853.
Bearings were: Beech 8", N15°W, 13 lks. and Beech 8", S15°W, 13 lks.
 - 10-Sec.5 South 1/16 Corner bet. Secs. 5-6.
 - E-2 Quarter Cor. bet. Secs. 4-5, set by Geo H. Cannon D.S. in 1853.
Bearings were: Beech 8", S54°E, 21 lks. and Beech 12", N45°W, 40 lks.
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- C-3 Found scribed post, probably set by H. Lawrence, R.L.S. with remains of Maple stump in proper position.
 - C-2 Re-established $\frac{1}{4}$ Cor. by single proportionate measure. No evidence of original corner.
 - 10-Sec.5 Established corner bet. $\frac{1}{4}$ Cor. to North and Sec. Cor. to South.
 - E-2 Re-established $\frac{1}{4}$ Cor. by sinle proportionate measure.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- Placed 1" pipe with 4" aluminium cap at all corners.
- C-3 New bearings: 6" W. Pine, S55°W, 23.9' and 8" B. Spruce, N11°W, 21.2'
 - C-2 New bearings: 8" Maple, S53°E, 5.0' and 8" Maple, N14°E, 26.7'
 - 10-Sec.5 New bearings: 8" Maple, S10°W, 36.0' and 6" Maple, S58°E, 5.5'
 - E-2 New bearings: 6" R. Pine, N16°E, 28.0' and 6" R. Pine, East, 21.8'

SIGNED BY Billy D. Buckler DATE 4-1-74

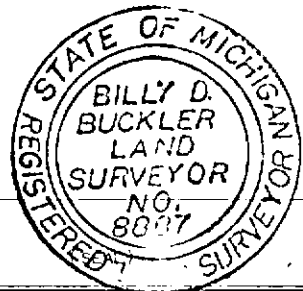

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____