

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Luce Co.

Four Corners.

FOR CORNERS OF -:	LOCATED IN -:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 46 ^{N.} X _{S.} , R. 10 ^{E.} X _{W.}	A-4 A-5 A-2 A-3
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ ^{N.} _{S.} , R. _____ ^{E.} _{W.}	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ ^{N.} _{S.} , R. _____ ^{E.} _{W.}	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 6/17 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
 All Corners set by Geo H. Cannon D.S. in 1853.
- A-4 $\frac{1}{4}$ Cor. on West side Sec. 7. Bearings: Fir 8, N40°W, 7 lks. Hemlock 16, N59°E, 61 lks.
 - A-2 $\frac{1}{4}$ Cor. on West side Sec. 6. Bearings: Hemlock 36, N30°E, 27 lks. Fir 12, N46°W, 26 lks.
 - A-5 Sec. Cor. common to Sec's 7-18 on Westside of Twp. Bearings were: Hemlock 14, S46°E, 30 lks. and hemlock 18, N54°E, 49 lks.
 - A-3 Sec. Cor. common to Sec's 6-7 on Westside of Twp. Bearings were: Hemlock 9, S27 $\frac{1}{2}$ °E, 33 lks and Y. Birch 9, N51°E, 35 lks.
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- A-4 Re-established midway.
 - A-2 Re-established by single proportionate measure.
 - A-5 Replaced corner, possible B.T. a hemlock, calls to swamp edges check.
 - A-3 Re-established by single proportionate measure from corners 1 mile North, and 1 mile South.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 All Corners 1" x 36" pipe with Dep't cap.

- A-4 New bearings: 6" S. Maple, N89°E, 16.1' and 6" S. Maple, S25°W, 7.1'
- A-2 New bearings: 10" S. Maple, S5°E, 11.7' and 8" S. Maple, N25°W, 0.8'
- A-5 New Bearings: 12" W. Pine, N30°E, 59.4' and 6" Maple, S45°E, 29.5'
- A-3 New bearings: 7" S. Maple, N71°W, 33.4' and 6" S. Maple, N73°E, 15.7'

SIGNED BY Billy D. Buckler

DATE 7/30/74

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

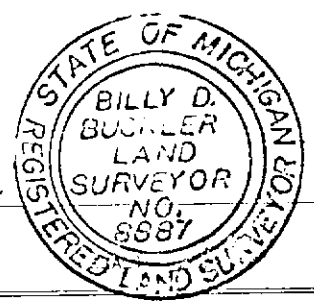

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____