

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Luce Co.

Four Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>46</u> ^{N.} S. , R. <u>10</u> ^{E.} W.	D-5 E-5 B-5 E-4
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ S., R. _____ E. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ S., R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 7/10 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- All set by Geo. H. Cannon D.S. in 1853.
- D-5 $\frac{1}{4}$ Cor. bet. sec's. 8-17. Bearings were: Sugar 16, N45°E, 27 lks.
Sugar 12, S72°W, 19 lks.
 - B-5 $\frac{1}{4}$ Cor. bet. sec's. 7-18. Bearings were: Beech 10, S54 $\frac{1}{2}$ °W, 25 $\frac{1}{2}$ lks.
Y. Birch, N5°E, 33 $\frac{1}{2}$ lks.
 - E-5 Sec. Cor. 8-9-16-17. Bearings were: Y. birch 20, N67 $\frac{1}{2}$ °E, 42 lks.
Hemlock 14, S44°W, 36 lks.
 - E-4 $\frac{1}{4}$ Cor. bet. Sec's. 8-9. Bearings were: Beech 12, N36°W, 38 lks.
Sugar 10, S50°E, 28 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- D-5 Re-established midway and on line bet. two sec. cors. Corner set at squared post.
- B-5 Cor. set at wood post setting at SW corner of spruce plantation. Re-established midway and on line bet. two section corners.
- E-5 Corner placed from possible B.T., a hemlock.
- E-4 Corner re-established midway and on line.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Placed 1" x 36" pipe with Dep't cap at all corners.
- D-5 New bearings: 8" R. Maple, N4°W, 33.0' and 10" R. Maple, N65°W, 37.6'
 - B-5 New bearings: 4" W. Pine, S5°W, 16.3'
 - E-5 New bearings: 4" W. Pine, S68°W, 15.7' and 12" Aspen, S70°E, 22.2'
 - E-4 New bearings: 8" Maple, S87°E, 58.7' and 10" Maple, S25°W, 36.8'

SIGNED BY Billy D. Buckler

DATE 7/30/74

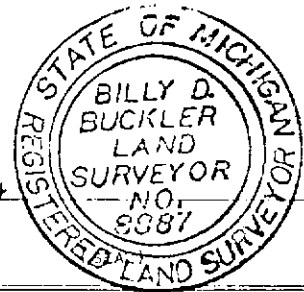

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____